

# U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The East Quarter corner of Section 1, T. 30 N., R. 11 E., Langlade County, WI

**Corner was:** (check all that apply)

Restored through acceptance of an obliterated evidence location.

Restored through acceptance of a found perpetuated location.

Determined to be lost and re-established through proportionate methods.

(Show bearings and distances to PLSS corners used for proportioning.)

Restored/recovered/reestablished in a location that differs from a previously established position. (Show difference in plan view below.)

Check here if additional information is shown on the reverse side of this form.

**Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.**

The original corner was established in 1853 by William T. Bradley. Original bearing trees: Maple 10" N87°W 20' links, Maple 10" N25°E 8' links. In 1896 B.F. Dorr visited this corner while doing work in Section 6, T30N, R12E, but gives no description of it.

In 1995 D. Higginbotham found a 3/4" rod at PI of N. Rollwood Rd and W Rollwood Rd. and accepted it as the E $\frac{1}{4}$  location and set out the following ties: 1"x30" iron pipe N41°W 46.76', 40D nail in 12" Basswood N64°E 21.79', 40D nail in 24" Oak S28°E 63.28', 1"x30" iron pipe S48°W 71.29'.

In 2002 I obtained a survey by Gary Radtke ( completed on 10-22-75 and filed as record # 30150 at Co. Surveyors Office) showing rock with chiseled in X at East  $\frac{1}{4}$  of Section 1. tied into Radtke survey and calculated East  $\frac{1}{4}$  position and found a 1 foot diameter rock with cross on top close to calculated position. (continued on back of sheet)

**Physical description of the monument set:**  
Set 1 $\frac{1}{4}$ " x 30" round iron bar set flush with ground.

**Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.**


#### LEGEND

• Existing 1"O.D. iron pipe

• Existing 3/4" iron bar


Bearings referenced to Section lines shown

Scale: 1"=30'

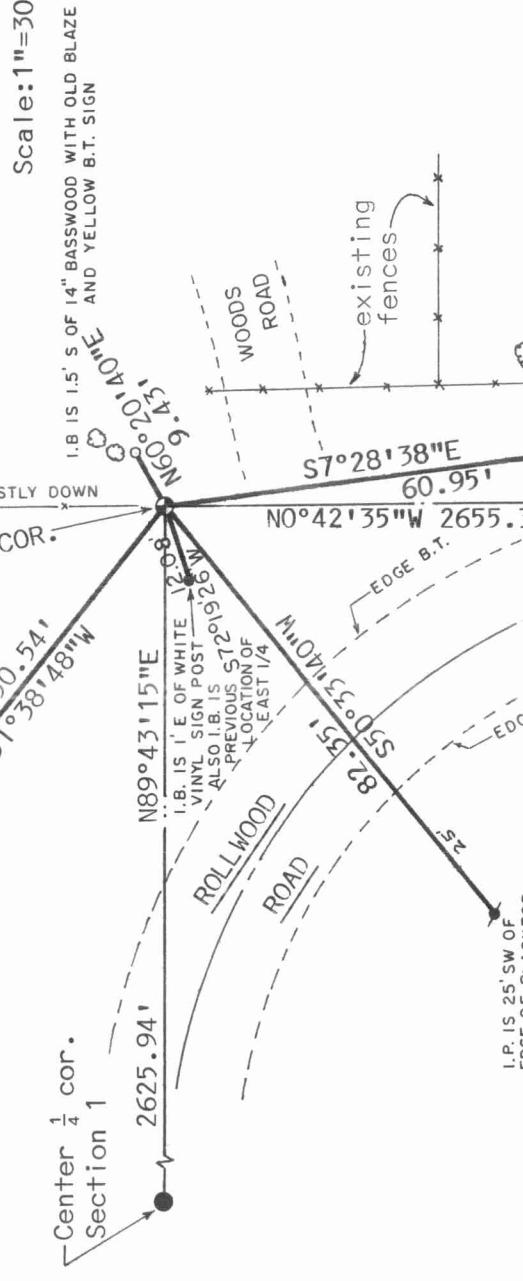

corner of Section 1  
T. 30 N., R. 11 E.  
Langlade County, WI  
The East  $\frac{1}{4}$

INDEX No. C25  
30-11

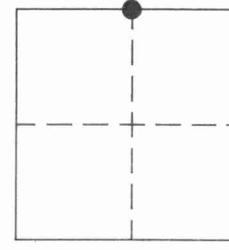


● = Location of corner

I, David J. Goslin, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

David J. Goslin 4-4-03  
Signature

Date

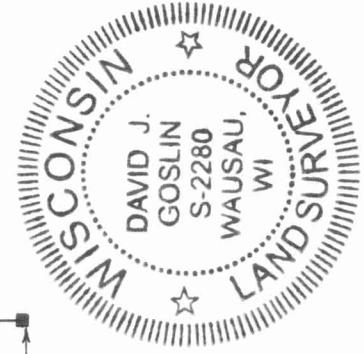

WISCONSIN ADMINISTRATIVE CODE

**Note:** A copy of the board-approved form is available from the Department of Regulation and Licensing, Bureau of Business and Design Professions, 1400 East Washington Avenue, P.O. Box 8935, Madison, Wisconsin 53708.

(3) MONUMENT RECORD REQUIREMENTS. A U.S. public land survey monument record shall show the location of the corner and shall include all of the following elements:

(a) The identity of the corner, as referenced to the U.S. public land survey system;

(b) A description of any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered by the surveyor, and whether the monument was found or placed;

(c) Reference ties to at least 4 witness monuments. Witness monuments shall be concrete, natural stone, iron, bearing trees or other equally durable material, except wood other than bearing trees;

(d) A plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed;

(e) A description of any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished;

(f) Whether the corner was restored through acceptance of an obliterated evidence location or a found perpetuated location;

(g) Whether the corner was reestablished through lost-corner-proportionate methods;

(h) The directions and distances to other public land survey corners which were used as evidence or used for proportioning in determining the corner location; and,

(i) The stamp and signature or seal and signature of the land surveyor under whose direction and control the corner location was determined and a statement certifying that the U.S. public land survey monument record is correct and complete to the best of his or her knowledge and belief.

**History:** Cr. Register, February, 1987, No. 374, eff. 3-1-87; am. (1) and (3)(c), Register, May, 1989, No. 401, eff. 6-1-89.

Believed stone was moved due to road construction in the past. Moved stone and set  $1\frac{1}{4}$ " x 30" round iron bar at calculated position from Radtke map. Iron bar is set flush with ground and set stone on west side of iron bar. From West  $\frac{1}{4}$  corner through Center  $\frac{1}{4}$  to set East  $\frac{1}{4}$  is a straight line as shown on Section Summary filed with County Surveyor. Accepted this location as best evidence of East  $\frac{1}{4}$  corner and tied out as shown below. East  $\frac{1}{4}$  is N72°19'26"E, 12.08 feet from previous East  $\frac{1}{4}$  location found and tied out by D. Higginbotham.