LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The South Quarter corner of Section 10, T. 34 N., R. 10 E., Langlade County, WI.

Corner was: (check all that apply)		4341010 0020	
	Restored through acceptance of an obliterated evidence location.		
X	Restored through acceptance of a found perpetuated location.		
	Determined to be lost and re-established through proportionate methods.		
	Show bearings and distances to PLSS corners used for proportioning, and show original distances	ances).	
	Restored/recovered/re-established in a location that differs from a previously established position.		
	(Show difference in plan view below).		
	Check here if addition information is shown on the reverse side of this form.		
Desci	ribe record evidence, recovered physical evidence, occupational evidence, testimonia	al	
	evidence and all other evidence considered in the recovery/restoration of the corner.		

The original corner was established in 1865 by James L. Nowlin. Original bearing trees: lind., 24", S71°E, 15 lks., and a birch, 8", N35°W, 20 lks. In 1899, Dorr made new BT: sugar, 7", N15-1/4E, 22 lks. and measured north, east and west from here. In 1937, Hintz described this corner as; "To 1/4 corner which falls in north ditch of road. Clearing on south side of road. Set witness corner 50 lks., north". In 1978, former surveyor Kelly located 4" brass cap witness corner set on 1938 re-survey of township. Set 1" iron pipe below road surface 33' south of witness corner and made 3 new BTs. and found a property corner; iron pipe S7°W, 37.67'. In 1985, Kelly re-marked the corner with railroad spike after 1985 road work, also 3 BT's., In 1998, D. Tlusty & D. Williams found RR spike in road, 32.05' south of the witness corner. Kellys BT's NE and SW are gone, SE tree is not usable. Accepted RR spike as found and added ties as shown below.

Physical description of the monument set:

For the corner, I left the RR spike as found. Set a white vinyl sign post 1.2' north of the 4" witness monument.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner. **LEGEND** O 1" iron pipe set 4" iron pipe w.brass cap fnd 3/4" x 30" re-bar set flush found RR spike 5" maple Bearings referenced to section S1/4 corner, Sec. 10 lines shown. Found RR spike SW corner, Sec. 10 set ip w/brass cap over pipe found. SE corner, Sec. 10 45.75° 2" ip w.brass cap 1899, Dorr, 2562.8' 1899, Dorr, 2585.22' 1937, Hintz, 2604.4' 1937, Hintz, N86°11'W, 2591.16' N 88°10'44" W 2576.19' S 86°12'42" E, 2588.19' Index No Moccasin Lake Rd. S71°09'28' W 82.70 S 70°35'55° E 95.17 15" maple O = corner perpetuated The South Quarter corner of Section 10,

J15

T. 34 N., R. 10 E., Langlade County, WI

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).


(a) identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

DRIGINAL CORNER ESTABLISHED BY JAMES L. NOWLIN IN JULY, 1865.

CORNER PERPETUATED ON 1938 RESURVEY & WITNESSED IN 1978.

CORNER RESET AFTER ROADWORK IN 1985

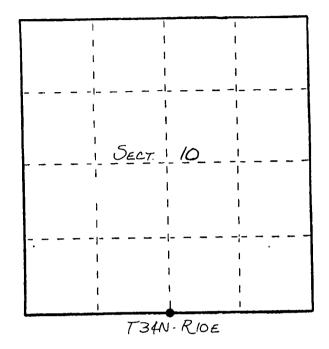

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.


SET R.R. SPIKE FROM EXISTING BT'S.

SCRIBED 2 NEW BT'S.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, in the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

 Describe witness monuments.
- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

MOCCASIN LE. RO

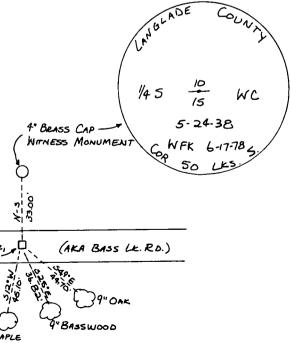

NORTH

(e)	Describe any material discrepancy between the location of the corner as restored or
	reestablished and the location of that corner as previously restored or reestablished
	by distance and direction. Show the discrepancy on the plan view drawing under (d).
	above. Show the distances between the corner as previously restored or reestablished
	and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness
	monuments shown on the drawing in (d), above.

NONE

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(2)

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

(i) I. WILLIAM F. KELLY
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

William & Killy 6-2-8

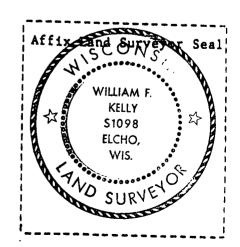

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

Index No. 9-15

MILWALKES
8
MILLER
ž.
985
FORM

State of Wisconsin