
PUBLIC LAND SURVEY MONUMENT RECORD U.S.

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- Identify the corner by (a) reference to the U.S public land survey system.
 - = Corner monument restored.

The East Quarter corner of Section 24, Township 34 North, Range 12 East, Langlade County, Wisconsin.

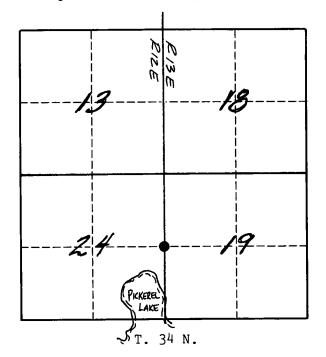

Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material (b) evidence you considered, and whether the monument was found or placed. The original corner was established in 1857 by Alfred Millard. OBT's: Hemlock, 12", N55E, 11.8 ft., hemlock, 10", S20W, 11.22 ft. C.E. Walker set a 2" iron pipe with brass cap for the corner in 1941, as evidenced by the monument that now exists. Ray Hallisy found Walkers pipe in 1970 and marked two maple BT's. 05/11/95 I found Walkers pipe and Hallisys BT's. I have no records of Walkers, but I do find a stump hole at the SW OBT location, and I find an old maple stump, 15" dia., that was cut about 30 years ago, and could be growing out of the OBT stump hole. I accepted Walkers monument as best evidence of theoriginal corner location, and reset it in place so that the top of it is 30" above ground in mound of stones.

In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a (c) municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) FB 5-156 Describe witness monuments.

BT's measured to the head of an aluminum nail set in a low blaze on the left side of each tree. BT's have BT sign nailed on tree facing corner, just above blue painted, bark smoothed band 5' above ground.

MARE 5

Show a plan view drawing depicting (d) the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

> The corner is on the north end of a 70'+ wide flat-top ridge that runs north-south.

SKETCH -NOT TO SCALE. BEARINGS WITH HAND COMPASS.

MPROVED LOGGING ROAD

1/4 CORNER SEC 24-34-12

2"I.P. WITH BRASSCAP IN MOUND OF STONES.

204 SET WHITE VINYL SIGN POST 0.5' SOUTH OF CORNER.

RE-MARKED EXISTING IZ"MAPLE BT

HEMLOCK 11

BE-MARKED EXISTING 7"MAPLE BT

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NO DISCREPANCY


- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location.?

 FOUND PERPETUATED LOCATION.
- (g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location.

(i) 1. DAVID E. TLUSTY LANGLADE COUNTY SURVEYOR

(type or print name)
certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature 5/12/95

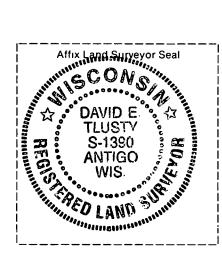

	State of Wisconsin							
	County of Langlade ss.							
	I Raymond J. Hallisy do hereby certify that on the 5th day of Sept. 19.70 I found evidence of the East \(\frac{1}{4}\) corner of Section 2\(\frac{1}{2}\) North, Range North, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.							
	Resident witnesses:							
	1 1							
	1 1 1							
	74							

○ = Corner monument restored.

CERTIFIED LAND CORNER RESTORATION

Index No. P - 23

History of original corner establishment:

Corner set by KXXXXXXXXXXXXX C. E. Walker 8/8/41

Description of corner evidence found:

Found 2" pipe with brass cap.

Description of monument and accessories I established to perpetuate the original location of this corner.

Did not set new pipe, added rock mound.

New B.T.'s

Hard Maple 8" SLOE 5 Ft. 10 inches Hard Maple 11" S60W 20 Ft. 5 inches B.T.'s faced at base of tree and scribed BT.



Dated at	Wis., this.	5th	dav of	Sept	. 19 70
Signature /	Title	Reg. L n	d Surveyor	٠.	Registration No. S-685
//County Surveyor, Register	ed Land Surve	yor, or other (luly authorized of	fficial)	_
Office of Register of Deeds, County of	***************************************			, l	hereby certify that the within
instrument was filed in this office for reco	ord on the		day of		19
ato'clock					
(Register of Deeds	······································		······		
, .,	•				