## LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The East Quarter corner of Section 27, T. 34 N., R. 12 E., Langlade County, WI.

Corne	er was: (check all that apply) 43	412272000
	Restored through acceptance of an obliterated evidence location.	
X	Restored through acceptance of a found perpetuated location.	
	Determined to be lost and re-established through proportionate methods.	
	Show bearings and distances to PLSS corners used for proportioning, and show original distances	s).
	Restored/recovered/re-established in a location that differs from a previously established position.	
	(Show difference in plan view below).	
	Check here if addition information is shown on the reverse side of this form.	

## Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.


The original corner was established in 1865 by James L. Nowlin. Original bearing trees: hemlock, 12", S57°W, 17 links and a birch, 16", S15°E, 20 links. In 1925, Malcolm Hutchinson established this corner by proportionate methods and marked a new BT: spruce, 17", N24°E, 27 links. In June of 1936 he measured west from this corner, 5318.45' to the W1/4 corner of Sec. 27. In 1970, Ray Hallisy: "Found wood stake down, marked W.C. 36 Links N. to Cor. 2" iron pipe." 36 links = 23.76' . He: "Set 2" iron pipe with brass cap in cement monument 4" x 2 Ft." and marked bearing trees for th WC. 08/14/04 D. Tlusty found Hallisys iron pipe with b/cap witness monument, bent and lying on ground on south side of road, but with no concrete. Approx. 23.76 feet north of destroyed WC, I found 2 railroad spikes, a PK nail and another small nail, all within 0.1'. From this position, Higginbotham measured 5323.35' to the W1/4 corner of Sec. 27 which is within 4.9' of Hutch's distance. I accept the evidence found as the best location for the 1/4 corner.

## Physical description of the monument set:

I replaced the existing spikes with a 3/4" x 30" rebar, top of which is 0.3' below the road surface. I set a Berntsen Deep1 magnet on the east edge of the rebar.

I straightened Hallisys WC (2" OD x 42" ip w/brass cap) and drove it flush with the ground as shown below.


Describe the accessories used to perpetuate the corner. Include a plan view drawing and

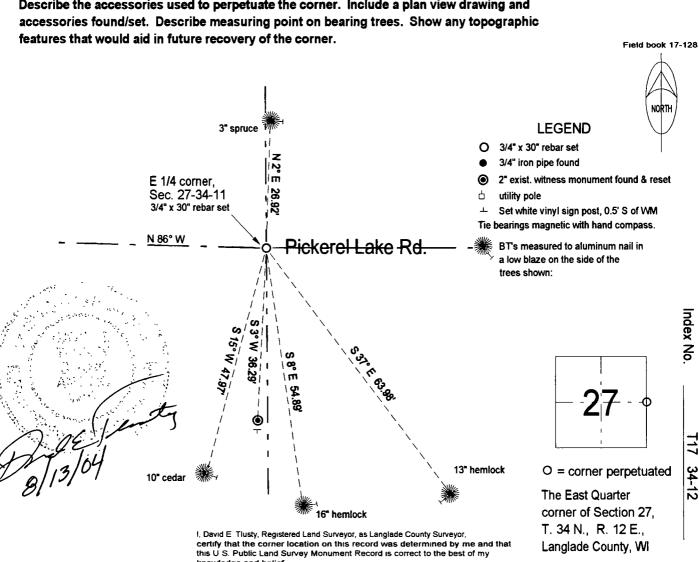

State of Wisconsin	ss.				
County of Longlade					

I Raymond J. Hallisy, do hereby certify that on the 5th day corner of Section 27 Township........., North, Range 12 Fourth, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

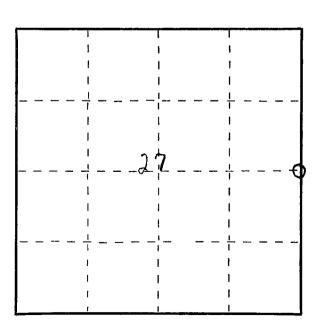

O = Corner monument restored.

Description of corner evidence found:

History of original corner establishment:

Found wood stake down, marked W.C. 36 Links N. to Cor. 2" iron pipe.

Description of monument and accessories I established to perpetuate the original location of this corner.

Set 2" ipon pipe with brass cap in cement ronume at \$2 4" by 2 Ft.

## KEXTXXXX

New B.T. 's Balsam 12 Links 30.6 Links S60E 10" He lock R.T.'s faced at base of tree and scribed BT.



Dated at	/nt go	Wis.,	this 5th	day of	Sep <b>t.</b>	19 70
Signatur	Jamen & S	elles Ti	tle Keg•	Land Surveyor	Registration	No. S-685
Office of I	(County Survey	yor, Registered Land	Surveyor, or oth	er duly authorized offici	Sept. Registration al) I hereby certify t	hat the within
instrumen	t was filed in this of	fice for record on a	the	day of	, I hereby certify t	, 19
al	Clock	. 141.				
	(Regi	ster of Deeds)	······································	••••••		
ъ			ъ			