LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The South quarter corner of Section 21, T. 30 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply) 43011210020

- [ ] Restored through acceptance of an obliterated evidence location.
- [X] Restored through acceptance of a found perpetuated location.
- [ ] Determined to be lost and re-established through proportionate methods.
  Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- [ ] Restored/recovered/re-established in a location that differs from a previously established position.
  (Show difference in plan view below).
- [ ] Check here if addition information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1853 by William T. Bradley. Original bearing trees: maple, 8", S21°E, 12 lks., and an elm, 12", N26°E, 11 lks. The original government survey distance each way from this corner was 2650.23 feet. The original Plat of Elmhurst shows the distance from this corner to the West as 2677 feet. Hutchinson used this corner for a survey in Section 28 in 1908, but he didn't describe it. In 1987, former surveyor Kelly apparently determined the corner was "lost" as he re-established it by single proportionate methods. He set a RR spike as the corner, an aluminum witness monument north, and some BT"S.
In 1996 I visited the corner and viewed sufficient occupation evidence to determine that Kelly erred in determining the corner was "lost". 04/27/00 D. Tlusty, Conrad Fleischman dug in the road on an extension of a row of very old, square rebar found on the East line of the cemetery. In the road, under 3 layers of pavement, we found a stone, approx. 5" x 8" x 12" with partial chiseled + on top. Accepted stone as the best evidence of the corner.
Conrad Fleischman indicated that this stone lines up exactly with where a fence to the South used to be and pointed out that the fence ran between the pine trees and an apple tree that is still there.

Physical description of the monument set:

Removed existing stone and replaced it with a 1" x 30" iron pipe set 26" below the road surface and set a 2" x 30" iron pipe with brass cap flush with road surface.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

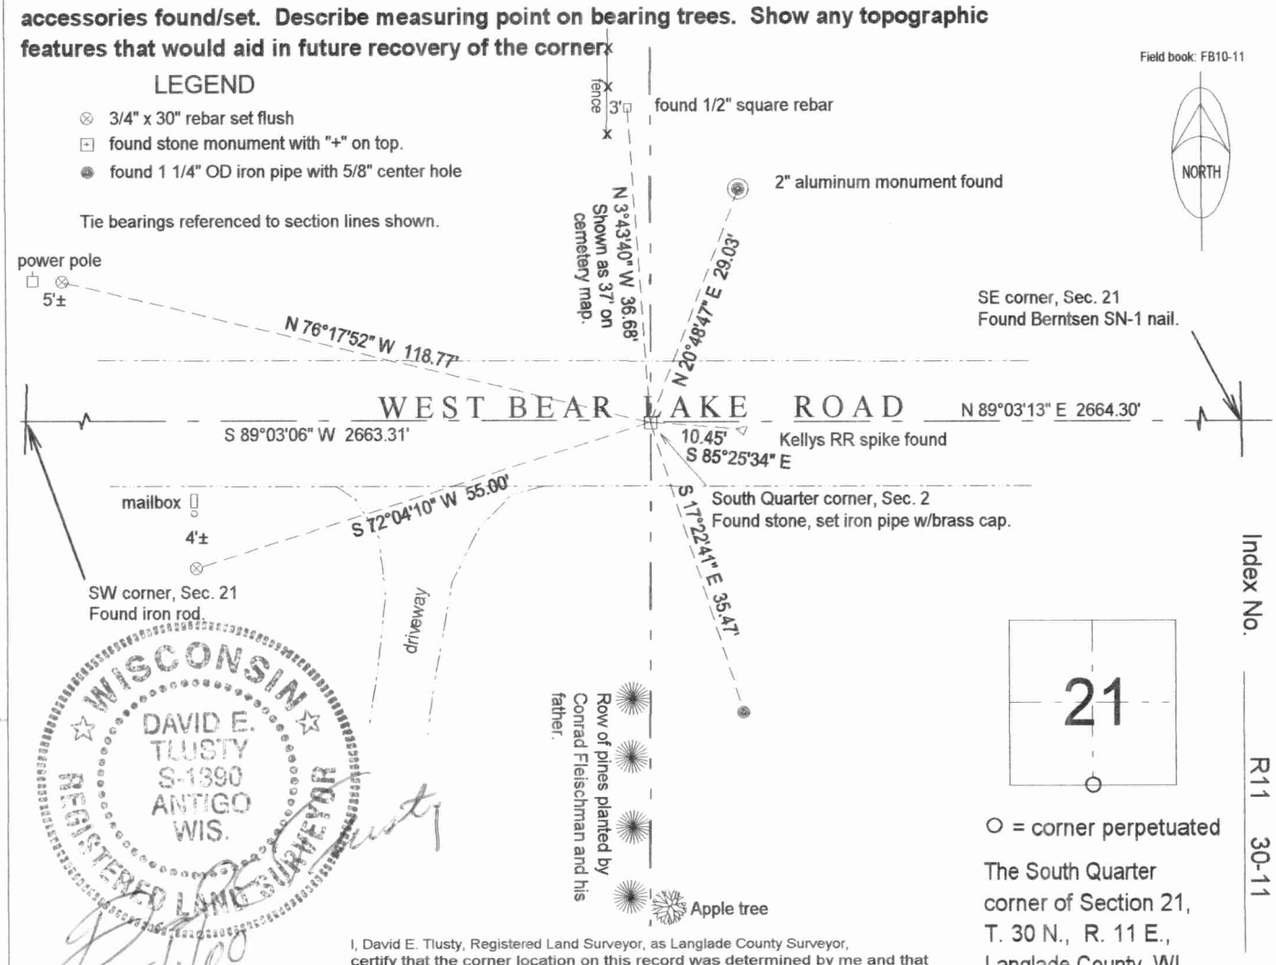

WISCONSIN
DAVID E. TLUSTY
S-1390
ANTIGO
WIS.
REGISTERED LAND SURVEYOR

5/1/00

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.

Index No. 21

○ = corner perpetuated

The South Quarter corner of Section 21, T. 30 N., R. 11 E., Langlade County, WI

R11 30-11