LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The South Quarter corner of Section 18, T. 33 N., R. 9 E., Langlade County, WI.

Corner was: (check all that apply) 43309180020

- [ ] Restored through acceptance of an obliterated evidence location.
- [X] Restored through acceptance of a found perpetuated location.
- [ ] Determined to be lost and re-established through proportionate methods.
  Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- [ ] Restored/recovered/re-established in a location that differs from a previously established position.
  (Show difference in plan view below).
- [ ] Check here if addition information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1860 by Hiram C. Fellows. Original bearing trees: hemlock, 11", N25°E, 12 links and a birch, 18", S20°W, 31 links. In May of 1902, Webly "found S OBT down. Set grey boulder 7x11x18 cross on top". He marked new BT's: hemlock, 12", N43°W, 41 links and a hemlock, 14", N 1 1/2° W, 98 links. 06/11/01 D. Tlusty, Emily Tlusty and Mike Kielcheski dug with backhoe. Down 2.5', found a grey boulder, approximately 7" x 11" x 18". Accepted it as the boulder mentioned by Webly and the best evidence of the original corner location.

Physical description of the monument set:

Removed boulder and replaced it with a 1" x 30" iron pipe, top of which is 2.2' below road surface. 12/09/2003 Set Berntsen SN-1 nail in new pavement. Corner falls approx. 5' north of center of pavement.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

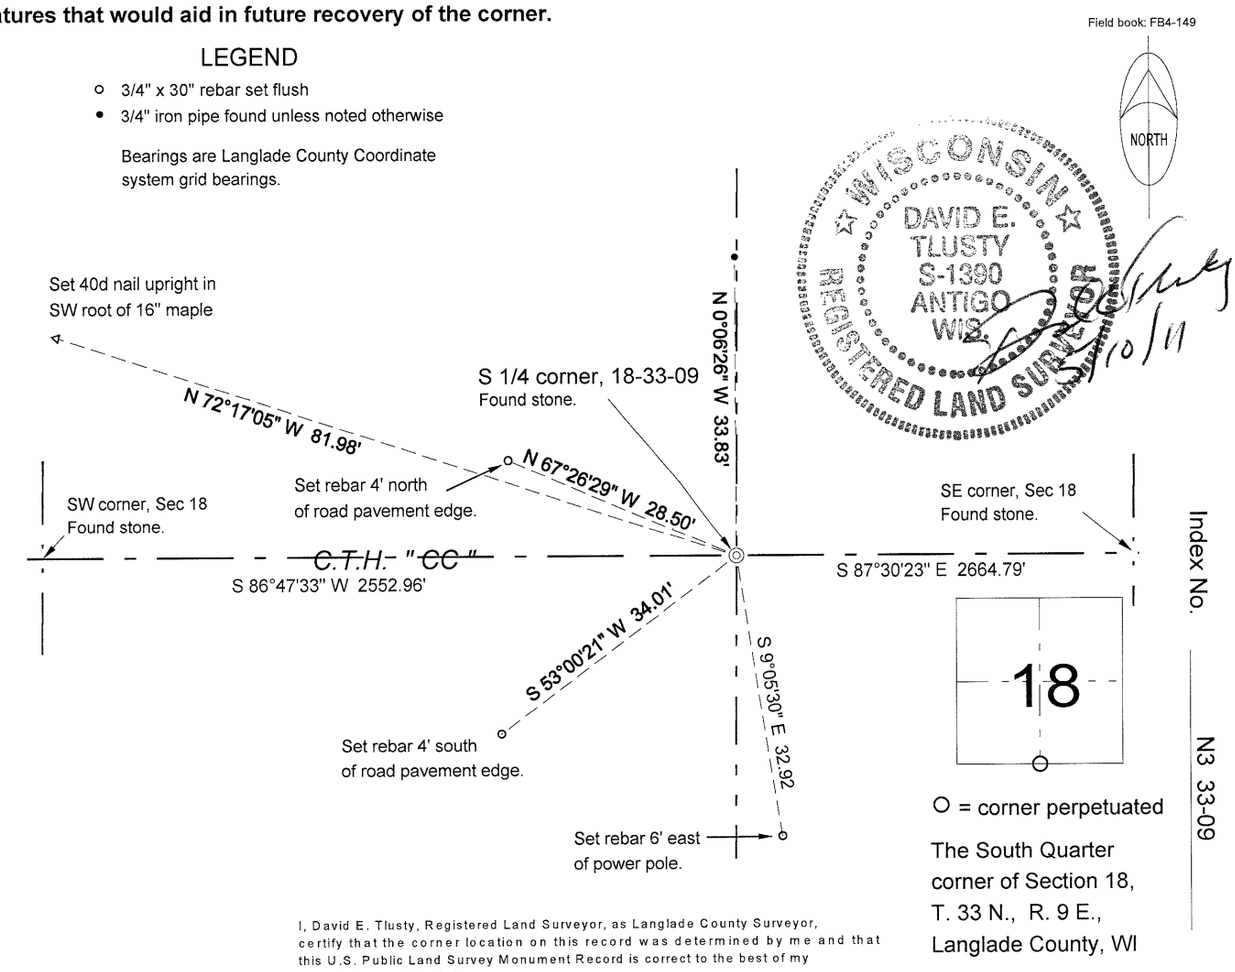

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.