LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The South Quarter corner of Section 33, T. 33 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply) 4331133 0020

- [ ] Restored through acceptance of an obliterated evidence location.
- [X] Restored through acceptance of a found perpetuated location.
- [ ] Determined to be lost and re-established through proportionate methods.
  Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- [ ] Restored/recovered/re-established in a location that differs from a previously established position.
  (Show difference in plan view below).
- [ ] Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1859 by Hiram Fellows. Original bearing trees: tamarac, 8", S27W, 12 links and a tamarac, 8", N80E, 8 links. Nov. 30, 1891, FB98, Pg. 42, BF Dorr surveyed in Section 33, measured to this corner from the North quarter corner of Section 33, but didn't describe this corner.
In the 1930's resurvey of 33-11, Hintz wrote: "Fnd 2 old scribed stakes 2 ft apart. Used E stake which conformed to both ogl BT's which are gone but roots. Course & dist. OK. New BT's: tamarac, 10", N24E, 46.4 ft; tamarac, 8", N33 1/2E, 33.6 ft. Bearing + on stone 4 x 6 x 10", N 79 1/2W, 35.4'. Set brass cap 9-19-36".
05/28/02 D. Tlusty, D. Williams found 4" iron pipe with brass cap in good condition in spruce & tamarac swamp. It is 35' East of high ground and 60' West of open water in small pond. Found existing 1936 bearing trees and + on rock. Accepted monument as found as the best evidence of the original corner location.

Physical description of the monument set:
I left the existing 4" iron pipe with brass cap in place. Set white vinyl sign post south, 1.0'.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

FB 17-143

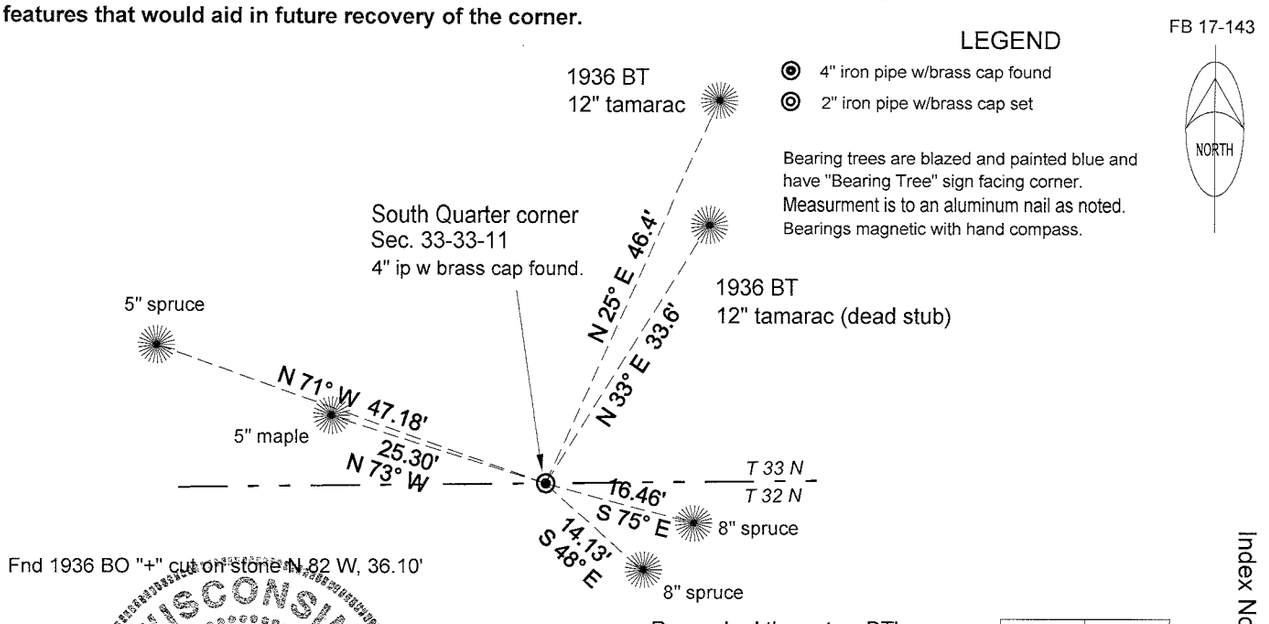

Re-marked these two BT's originally marked by Hallisy.

WISCONSIN
DAVID E. TLUSTY
S-1390
ANTIGO
WIS.
REGISTERED LAND SURVEYOR
2/22/2010

Index No.
33
Z 11 33-11

O = corner perpetuated

The South Quarter corner of Section 33, T. 33 N., R. 11 E., Langlade County, WI

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.