LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The East Quarter corner of Section 1, T. 34 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply) 4341101 2000

- ☐ Restored through acceptance of an obliterated evidence location.
- ☒ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re-established through proportionate methods.
  Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- ☐ Restored/recovered/re-established in a location that differs from a previously established position.
  (Show difference in plan view below).
- ☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1857 by Deputy Surveyor Alfred Millard. In the 1930's, C.W. Borth found original spr. pine BT at S30E, 92 links (60.7') standing dead. He found the original tam. BT NW, down. He set and scribed new cedar 1/4 post and marked a new BT: Fir, 10",N95E, 12.5 feet. In 1987, Ray Hallisy found "scribed cedar post down - point in ground". He found original spruce pine BT, 10", S30E, 92 links and said "scribe marks plain and visible". He set a 3" aluminum pipe with cap. On May 4, 2017, I found Hallisy's aluminum capped pipe in good condition, top up 15". Pipe is on East side of 3' tall, 6" x 6" wood post. Also found pine stump, S37E, 62 feet. I accepted the aluminum monument as the best evidence of a perpetuation of the original corner and mark the BT's shown below.

Physical description of the monument set:

I left the existing monument in place and set a white vinyl sign post 0.7' north of the monument.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

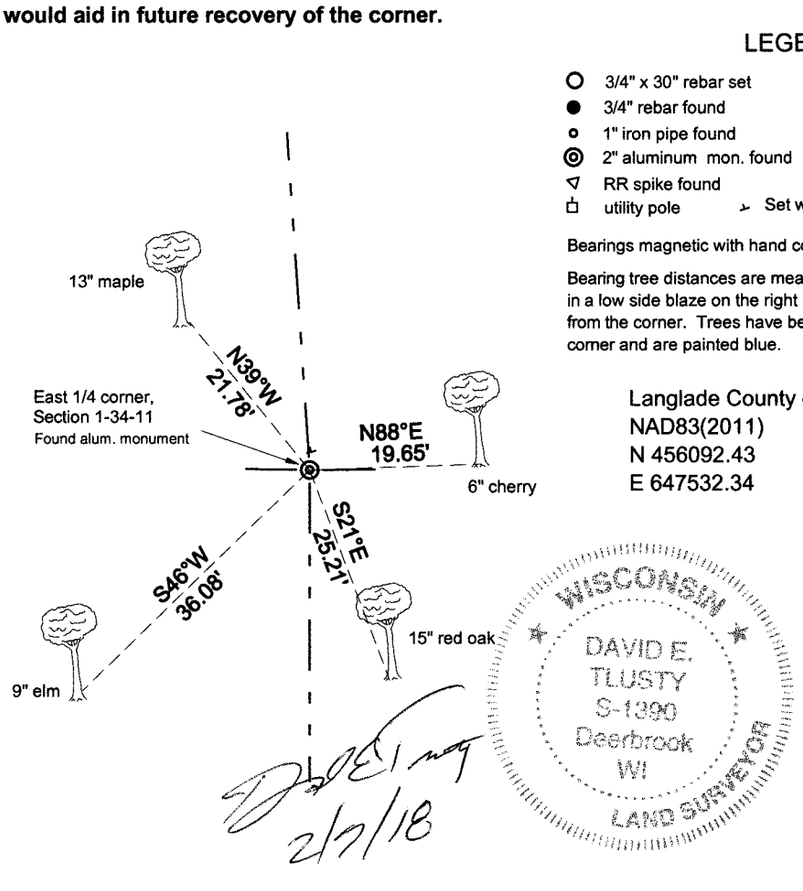

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.

Index No. C 25 34-11