RECORD SURVEY MONUMENT U.S. **PUBLIC** LAND


INSTRUCTIONS

This record shall show the location of the corner and shall include all of the following nine elements (a through i)

- Identify the corner by (a) reference to the US public land survey system
 - = Corner monument restored

The East Quarter corner of Section 10, Township 34 North, Range 11 East, Langlade County, Wisconsin.

SEE 10/7/08 UPDATE ON REVENSE DITENTY

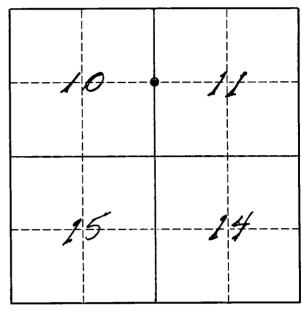

T. 34 N., R. 11 E.

Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material (b) evidence you considered, and whether the monument was found or placed The original corner was established in 1859 by William E. Daugherty. Original bearing trees: Hemlock, 10", N50°W, 35 lks., and a Birch, 8", S55°E, 10 lks. In April, 1924, W.C. Webly (FB101-104) indicated that this corner was a stone previously set by Dorr and used this corner to set the center of Sec. 10 and the CE 1/16 corner (pump point) of Sec. 10. In May, 1926, Malcolm Hutchinson (FB107-29) measured from this corner East

to an MC and the E_4^1 corner of Sec. 11. In July, 1971, Rob't. Poss "found pipe set by Duchac in 1929 Wisc. Power & Light survey". He replaced that pipe with a 2" pipe with brass cap. In Nôvember 1993, to re-set this corner, I re-set the center of Sec. 10 from Weblys' BT stump and then extended a line from this center, East through Weblys'CE1/16 well point found, and at the same distance as from C_4^1 to CE1/16, I re-set the corner on the center of Pratt Road. Set broken PK as temporary corner

marker. This position is in agreement East & West with (continued on reverse) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments (Witness monuments shall be made of concrete, natural stone, iron or other FB6-66 62 equally durable material)

38.68

Describe witness monuments
O = 3/4" x 30" re-bar with red plastic cap set flush with ground. Ties measured electronically.

> (ASSUMED) N85 33'42 W

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north

cluster of 3-14 oaks

BUILDING sw corner of Concrete slab

TELEPHONE

589°06'05'E white viny/ sign post set

"iron pipe found

El4 con 10-34-11 5/26/94 SET RR SPIKE FOR CORNER

Y"Oak leaning East

2970.08

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

See discrepancy as shown on sketch below.

Hutchinson's distances through Sec. 11 and falls in very good alignment with Poss*s Center of Sec. 11 and the E_4^1 corner of Sec. 11. See comparative distances below. As Poss's pipe (130' west of Pratt Road) computes to be within 5 feet of a single proportionate position, it appears that Duchac, in 1929, didn't have Webly's or Hutchinsons notes and set the corner by single proportionate measurement between the NE and SE corners of Section 10.

Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location.? (f) Corner was restored as described above.

10/07/08 D. Tlusty checked and added ties for the E1/4 cor, Sec 10-34-11 Pratt Road is being rebuilt and the existing railroad spike will be destroyed. The NW rebar is destroyed. The others shown on the face of this form are OK and measure as shown. I measured to the following:

 $\frac{3}{4}$ " x 30" rebar set, N50°51'03"W, 46.63' set 3' east of a 6" white pine. 3/4" x 30" rebar set, N50°10'54"E, 69.73' set 3' SW of a 15" oak. Found 2" ip with brass cap (Poss corner), N79°51'34"W, 133.88'.

DUG FOR STONE MENTIONED 10/06/08 BY HUTCHINSON IN FBIZZ-146. FOUND ONE I STONE THE STATED SIZE (32"LONG) BUT NO CHISCLED"X'S PER HUTCHINSON.

Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner

location. NE COR SIO IP. IN ROAD

NOTE: All measurements shown below are based on open traverses and could be subject to minor adjustments.

SKETCH - not to scale!

CORNER C'/4 S10 SET FROM ON, 1926, 5809.32 CE 1/16 1993, 5806.98 BT STUMP AD WELL 180.01,00 1485.04 WEBLY, 1924, 2967.36' MEASURED, 1993, 2970.08' C/4 511 BRASS CAP IN CONCRETE E/4 CORNER SEC. 10-34-11 AND CTR 1/4 511. RE-SET BY TOM ARNOTT FROM OLD B.T.

NOTE: KELLY'S M.C. HERE IS 10.1 FT. NORTH OF LINE BETWEEN EYY COR SIO

(MK. FACLS IN WATER)

David E. Tlusty, Langlade County Surveyor (type or print name)

certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Affice Land Sulveyor Seal .1390

E 44 SII

SPIKE FUD

State of Wisconsin County of LANGLADE I ROBERT J. S. do hereby certify that on the 2ND day of JULY 19.71 I found evidence of the 14 corner of SECS 10 \$ 11 Township 34 North, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner. Resident witnesses:				
Sec.10	Sec_4			


O = Corner monument restored.

History of original corner establishment:

FOUND PIDE SET BY DUCHAC IN 1929 WIS. PWR. ELT. SURVEY.

Description of corner evidence found:

FOUND IRON PIPE & 3 TREES W SCARS.

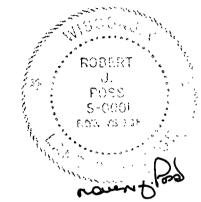

Description of monument and accessories I established to perpetuate the original location of this corner.

SET 2" PIPE W| BRASS CAP MKD 1/4 COR Sec. 10. Sec.11 T 34N RILE

PRATT

1= OAK 14 N24W 24'z

4 : OAK 10 550W 26.8 5= OAK 10 N 28E 20.0

6: POPPLEIZNGE 7"

2: OAK 10 S 85E 20'
3: OAK 10 S651/2 W 28'2'
BLAZED & SCRIBEDNBT

SCARS- DIDNOT BLAZE

Dated at ELCHO	Wis., this 12 TH	day of Juc.	Y 1971
Signature (County Surveyor) Register		<u> </u>	•
Office of Register of Deeds, County of		I h	ereby certify that the within
nstrument was filed in this office for rec	ord on the	day of	
to'clock		•	

(Register of Deeds)