LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The Meander corner between Sections 11 & 14, T. 34 N., R. 12 E., Langlade County, WI.

Corner was: (check all that apply)				
	Restored through acceptance of an obliterated evidence location.			
X	Restored through acceptance of a found perpetuated location.			
	Determined to be lost and re-established through proportionate methods.			
	Show bearings and distances to PLSS corners used for proportioning, and show original distan	ces).		
	Restored/recovered/re-established in a location that differs from a previously established position.			
	(Show difference in plan view below).			
	Check here if addition information is shown on the reverse side of this form.			


Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1865 by James L. Nowlin. Original bearing trees: hemlock, 20", S20°W, 6 links and a hemlock, 10", N40°W, 12 links. In 1909, Brooks said "orig BT's all gone but one rotten stump, new poplar, 9", N81°W, 29 & stone in place with + and marked BT is N72°W, 0.07." In April, 1975, former surveyor Kelly "located 2" iron pipe identified by resident witness as the meander cor. Set 2" ip w brass cap & ties." In 2001, I found Kellys IP and noted that the distance from his pipe to the section corner west was approximately 30' short of original gov't. dist. Further searched revealed the 1909 poplar BT @ about N40°W, 6' from Kellys IP. The poplar stump is mostly rotted away except for the harder wood around the blaze heal mark facing the lake. Brooks' bearing and distance from this stump falls in the rock outcropping at the shoreline which would be in harmony with Brooks statement that he marked a stone only 0.07 ch (4.6') from the corner. I accept the poplar BT stump as the best remaining evidence of the original corner location and measured Brooks distance on a corrected bearing to set a 3/4" rebar at the original meander corner location.

Physical description of the monument set:

I set a 3/4" x 30" rebar for the corner.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

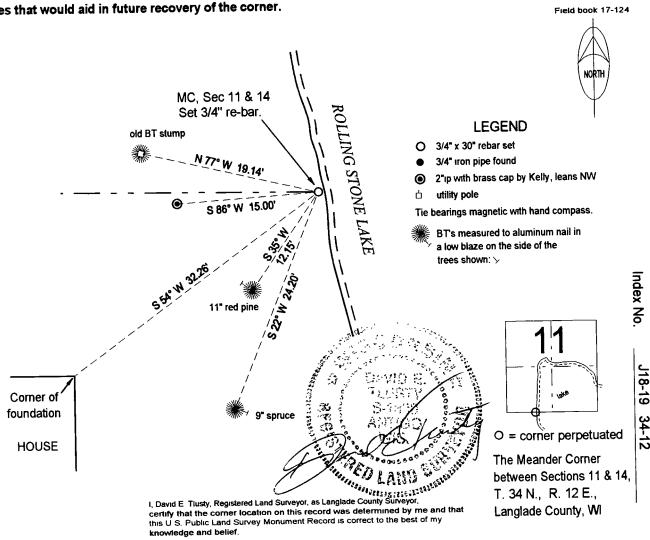

CERTIFIED LAND CORNER RESTORATION

History of original corner establishment:

2" IRON PIPE SET ON SURVEY IN 1965 BY P. HANSEN.

BALL Follo for for me 1172 W T 6 - and of

Description of corner evidence found:

Index No. J-18-19 KELLY \$1098 ELCHO, LOCATED 2" IRON PIPE IDENTIFIED BY RESIDENT WITNESS AS THE MEANDER CORNER.

Description of monument and accessories I established to perpetuate the original location of this corner.

4'*6' BOULDER AT SHORE LINE + 07

SET 2" BLACK IRON PIPE WITH BRASS CAP MARKED: 2" B.I.P. WITH BRASS CAP. 535°W-20,97' 15 14

Dated at ELCHO	, Wis., this	? ≌	day of	APRIL	, 19. 75
Signature William J. (County Surveyor	Kellig Title Ri	GISTERED or, or other dul	LAND SURVEYO	OR Regis	tration No. \$1098
Office of Register of Deeds, Construment was filed in this office ato'clock	ce for record on the				
(Regist	er of Deeds)		-		