


William F. Kelly  
1-15-1990

I, WILLIAM F. KELLY, REGISTERED LAND SURVEYOR, HEREBY CERTIFY THAT I HAVE HAD SECTION 32 OF TOWNSHIP 32 NORTH RANGE 9 EAST SURVEYED FOR THE PURPOSE OF ESTABLISHING THE BOUNDARIES OF THE NORTHWEST 1/4 OF SECTION 32 T32N-R9E. SAID SURVEY HAS BEEN MADE AT THE REQUEST OF W. WING AND THE LANGLADE COUNTY FORESTRY DEPARTMENT. THAT SAID SURVEY TO RETRACE THE BOUNDARIES OF SECTION 32 HAS BEEN MADE UTILIZING BOTH SINGLE AND DOUBLE PROPORTION MEASUREMENTS TO ESTABLISH THE MISSING CORNERS THAT THE NORTHWEST CORNER OF SECTION 32 AND THE WEST 1/4 CORNER OF SECTION 32 WERE REESTABLISHED FROM PAWLE WITNESS BY H. PETERSON AND FROM SURVEYS MADE BY M. HUTCHINSON AND B. F. DORR. THAT THE NORTH-SOUTH LANDMARKS CALLED FOR IN THE ORIGINAL GOVERNMENT SURVEY CHECK WITHIN REASON, BUT THAT THE EAST-WEST LANDMARKS CALLED FOR IN THE ORIGINAL GOVERNMENT SURVEY CAN NOT BE IDENTIFIED. THAT SAID SURVEY HAS BEEN MADE UTILIZING ACCEPTED PRACTICES FOR THE RETRACEMENT OF SECTION LINES OF THE PUBLIC LAND SURVEY.


NORTHWEST CORNER, SECTION 32 - CORNER ORIGINALLY SET BY H. C. FELLOWS IN SEPTEMBER, 1860. CORNER WAS RESET BY B. F. DORR BY USING ORIGINAL B.T.S. DORR SET A PIECE OF PUMP 3" X 18". WE SEARCHED FOR PUMP BUT COULD NOT LOCATE IT. RESIDENT HERMAN PETERSON SAID CORNER WAS AT INTERSECTION OF ROADS. WE SET CORNER AT INTERSECTION OF ROADWAYS. DISTANCE TO NW CORNER OF SECTION 29 (5379.58') AGREES WITH DORR'S (5374.71').

WEST 1/4 CORNER, SECTION 32 - CORNER ORIGINALLY SET BY H. C. FELLOWS IN SEPTEMBER, 1860. CORNER CALLED FOR IN M. HUTCHINSON NOTES DATED OCTOBER 31, 1940. HUTCHINSON DID NOT CALL FOR A SPECIFIC TYPE OF MONUMENT. WE SEARCHED WITH METAL DETECTOR BUT FOUND NO MONUMENT. SET CORNER AT INTERSECTION OF CENTERLINE OF ROAD AND OLD FENCE LINE. EXTENDED CORNER CHECKED GOOD FOR DISTANCE FROM BOTH NW AND SW CORNERS OF SECTION 32.

NORTHEAST CORNER, SECTION 32 - CORNER ORIGINALLY SET BY H. C. FELLOWS IN SEPTEMBER, 1860. WE FOUND NO EVIDENCE OF CORNER. SET CORNER BY DOUBLE PROPORTION USING THE NW CORNER OF SECTION 32 AND THE N1/4 CORNER OF SECTION 34 FOR EAST-WEST CONTROL, AND THE NE CORNER OF SECTION 29 AND THE SE CORNER OF SECTION 32 FOR NORTH-SOUTH CONTROL.

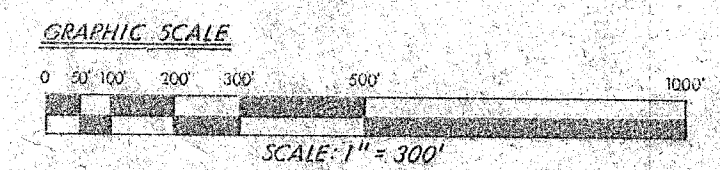

BASIS OF BEARING: WEST LINE OF NORTHWEST 1/4 OF SECTION 32 ASSUMED NORTH-SOUTH

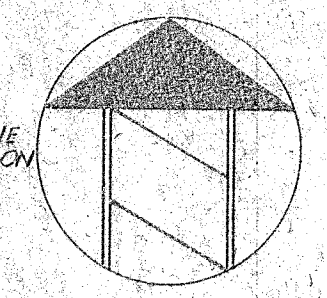

- LEGEND**
- ⊕ 4" (OUTSIDE DIAMETER) IRON PIPE WITH BRASS TABLET FOUND
  - ⊙ 1 7/8" (OUTSIDE DIAMETER) X 42" IRON PIPE WITH BRASS CAP SET
  - ⊗ 2 1/4" (OUTSIDE DIAMETER) X 42" IRON PIPE WITH BRASS CAP SET
  - ⊖ 1" (OUTSIDE DIAMETER) X 30" IRON PIPE SET
  - ⊙ SPIKE SET
  - \*— FENCE LINE

**CORNER ACCESSORIES**

COR.	ACCESSORIES
1	9" BALAM, N38°E, 45.75'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, S40°E, 70.00'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, N85°W, 33.00'
2	7" SPRUCE, S40°E, 41.43'; 1" X 30" IRON PIPE, N84°W, 30.00'; 1" X 30" IRON PIPE, S84°E, 30.00'
3	18" SPRUCE, S70°E, 51.23'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, EAST, 66.00'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, WEST, 50.00'
4	18" SPRUCE, S65°W, 48.39'; 1 7/8" X 42" IRON PIPE W/BRASS CAP, EAST, 30.00'; 1 7/8" X 42" IRON PIPE W/BRASS CAP, WEST, 33.00'
5	5" MAPLE, S85°W, 45.81'; 1" MAPLE, N45°E, 33.15'; 1" MAPLE, N67°E, 36.43'
6	POWER POLE, S60°W, 34.22'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, S79°E, 33.00'; 2 1/4" X 42" IRON PIPE W/BRASS CAP, S79°E, 75.00'
7	12" ELM, N25°W, 84.58'; 13" MAPLE, N58°E, 92.00'; 26" ELM, S40°E, 106.47'
8	9" BALSAM, N88°W, 51.53'; 14" BALSAM, N36°E, 11.28'; 10" BALSAM, S53°E, 14.55'
9	12" MAPLE, SOUTH, 8.68'; 12" ASH, N82°W, 31.04'; 7" MAPLE, N73°W, 23.15'; OLD BEARING STUMP, N14°W, 28.90'
10	6" MAPLE, S35°E, 15.13'; 7" MAPLE, N80°W, 35.48'; 9" MAPLE, N20°W, 36.77'; OLD BEARING STUMP, N63°W, 48.8'
11	CORNER PREVIOUSLY RESTORED (SEE CORNER RESTORATION SHEET)

BUILDERS SERVICE ENGINEERING DIVISION

SECTION SUBDIVISION

SECT. 32 T32N-R9E

LANGLADE COUNTY

DRAWN BY: M. STIBBE

SCALE 1" = 300'

DATE 1/15/1990

SHEET 1 OF 1

NO. 627

RECORD # 4005  
LANGLADE COUNTY SURVEYORS OFFICE  
DATE FILED: 5/28/93 BY: D.J.