

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The NORTHEAST corner of Section 1, T. 30 N., R. 11 E., Langlade County, WI

Corner was: (check all that apply)

- Restored through acceptance of an obliterated evidence location.
 - Restored through acceptance of a found perpetuated location.
 - Determined to be lost and re-established through proportionate methods.
(Show bearings and distances to PLSS corners used for proportioning.)
 - Restored/recovered/reestablished in a location that differs from a previously established position. (Show difference in plan view below.)
 - Check here if additional information is shown on the reverse side of this form.
- Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.
- This corner was established in 1853 by William J. Neely. Original BT's: birch, 14, S87°W, 35 lbs.; maple, 12", S20°W, 44 lbs., and an elm, 10", S75°E, 59 lbs. He intersected the township line, 29.65 chains (1956.90 feet) west of the corner of Sections 34 & 35. In 1898, Dorr measured from this corner to the east 1966.14 feet (assumed to the SE cor. Sec 34) and 4750.02 feet (assumed to the NE cor. Sec 6). It appears that this area has been bulldozed at sometime in the past. I find no evidence of the corner. I re-established the corner by single proportionate measurement and on the South line of the SE quarter of Section 34. See comparative distances below. I perpetuate this location with the monument described below.


Physical description of the monument set:

Set a 2" x 42" aluminum pipe with 3 1/4" aluminum cap, flush with the surface of the ground.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

o = 3/4" x 30" rebar with red plastic cap set flush with ground.


τ = white vinyl sign post with "Survey Marker" sign set, 1' SE of corner

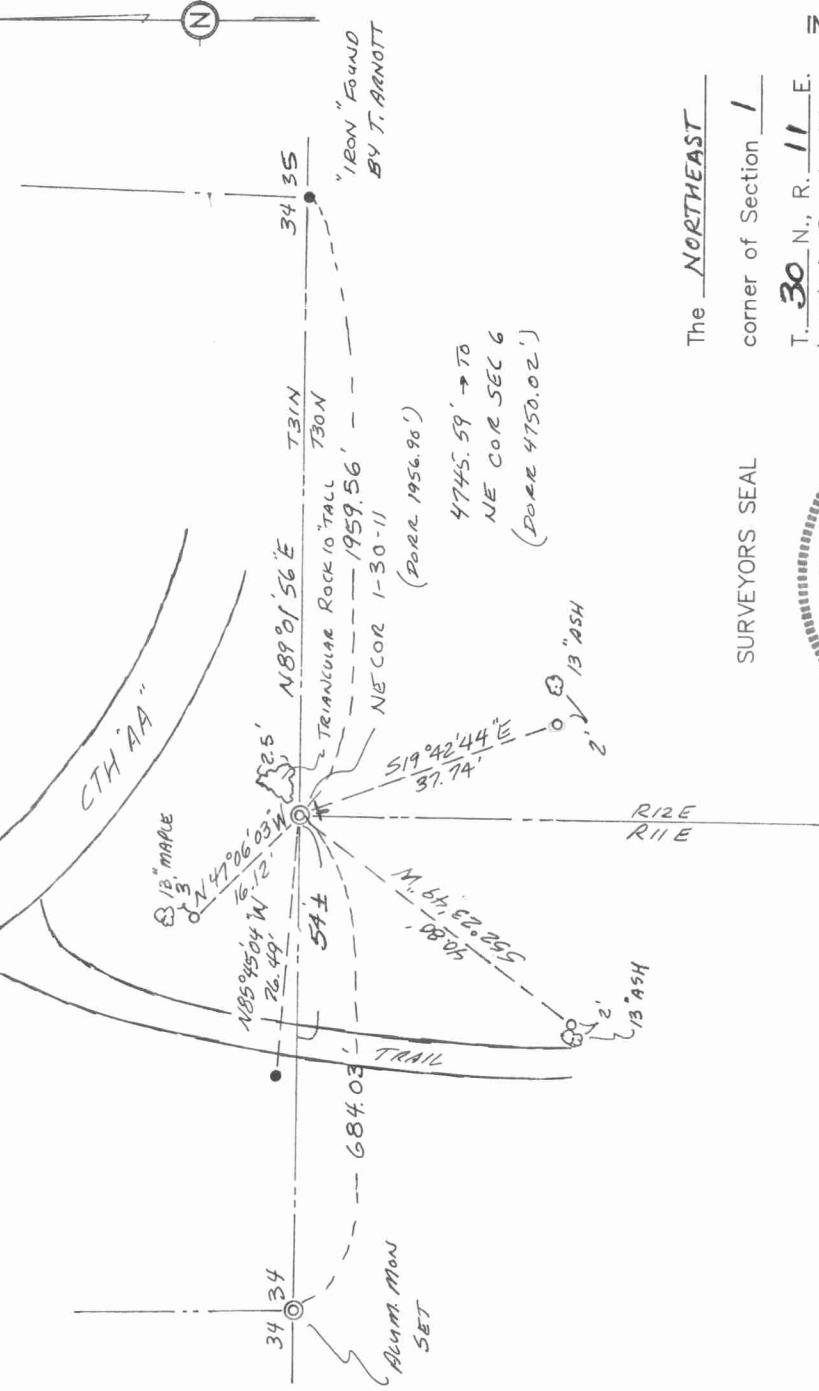

SURVEYORS SEAL

T. 30 N., R. 11 E.
Langlade County, WI

INDEX No.

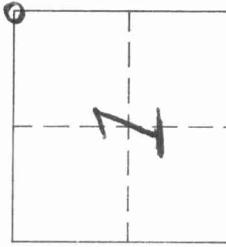

O = Location of corner



Date

Signature

DAVID E. TRUSTY,
LANGLADE COUNTY SURVEYOR, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

30-11
A25

