

4320926 2020

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The Center 1/4 corner of Section 26, T. 32 N., R. 9 E., Langlade County, WI
Corner was (check all that apply)

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
- Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
- Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.

Corner was not established by original survey.

1915 - Hutchinson subdivided section, set center (BTs 20" Birch, N52W, 22.5 links, 12" Hemlock, S46W, 39 links), and indicated distances to the 1/4 corners- N 42.41 ch. (2799.06'), E 39.49 ch. (2606.34')

2007 - I found a standing 8' tall fence running East and South. The distances from the fence corner to the N & E 1/4 corners matched well with Hutchinson's 1915 survey. Also found a triangular shaped wooden post dislodged near fence corner. I accepted the fence corner as the best available evidence of Hutchinson's section subdivision.

Physical description of the monument set:

I set a 1.32" x 24" iron pipe and tied it out as follows.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

NORTH 1/4 CORNER
SECTION 26
FOUND BERNTSEN NAIL

*All Bearing Trees with aluminum signs, no blazes.
*Distance measurements taken to nail in base of tree.

- 1 - N13° 30'E, 17.21', NAIL IN BASE OF 6" BLACK ASH BEARING TREE
- 2 - S79°W, 14.01', NAIL IN BASE OF 5" BASSWOOD BEARING TREE
- 3 - S0°E, 30.39', NAIL IN BASE OF 8" YELLOW BIRCH BEARING TREE
- 4 - NW 1.6', WHITE PLASTIC T-POST

BEARINGS TO PLS CORNERS REFERENCED TO THE LANGLADE COUNTY COORDINATE SYSTEM GRID. BEARINGS TO BT'S ARE MAGNETIC




DEER FARM FENCE

The CENTER 1/4

Corner of Section 26


T. 32 N., R. 9 E.
Langlade County, WI

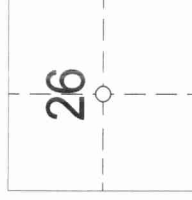

○ = Location of corner

SURVEYORS SEAL

SOUTH 1/4 CORNER
SECTION 26
SET THIS SURVEY

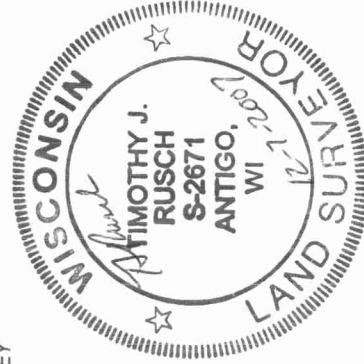

I, Timothy J. Rusch certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Timothy J. Rusch

Signature

Date