

# U.S. PUBLIC LAND SURVEY MONUMENT RECORD

**THIS RECORD SHALL SHOW THE LOCATION OF THE CORNER AND SHALL INCLUDE ALL OF THE FOLLOWING NINE ELEMENTS (A THROUGH I).**

CORNER MONUMENT RESTORED:

EAST QUARTER CORNER, SECTION 17, T32N, R10E,  
Town of Peck, Langlade County, Wisconsin.


(a) Identify the corner by reference to the U.S. public land survey system.

ORIGIN: Township subdivision by H.C.Fellows  
in 1860; BB. pg.131, set post.

PERPETUATION:

1916 M. Hutchinson FB. 122, pg. 34 &  
BB. Pgs. 158-159 Section subdivision.  
Set post.

1974 WF Kelly Found Hutchinson's BT Blaze  
Set 2" Iron Pipe w/ brass cap next to  
2 1/2" angle iron

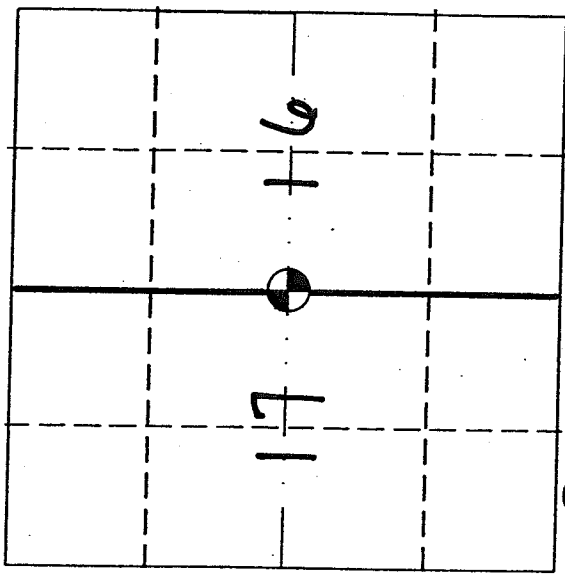

☉ = corner monument restored.

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Found Kelly's 2" iron pipe w/ brass cap on 9-8-95 under thick vegetation. Could not identify any of the numerous rotted treefall as possible bearing trees and there was no evidence of the down fence line.

Accepted 2" pipe w/ brass cap and installed new ties as shown below. Bearing tree signs were placed at eye level as witness tie locators.



(c) In the plan view drawing below, provide reference ties to at least four witness monuments, or, if the location is within a municipality, to at least two witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

LEGEND:

- ☉ 2" IRON PIPE w/BRASS CAP
- 3/4" x 30" REBAR SET  
wt.= 1.50lbs/ft.

NO SCALE

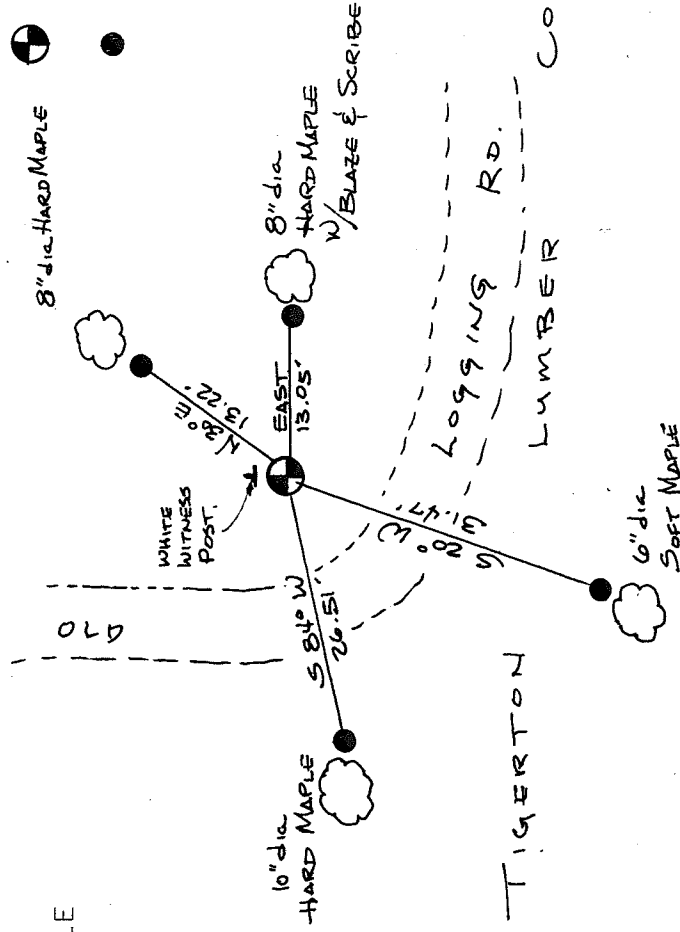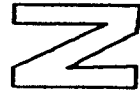

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least two of the witness monuments shown on the drawing in (d), above.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or (2) a found perpetuated location?

THIS WAS A FOUND PERPETUATED LOCATION

(g) & (h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?


(i) I, STEPHEN J. FAULKES RLS #1942

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Signature

Stephen J. Faulkes 6/14/96

Date

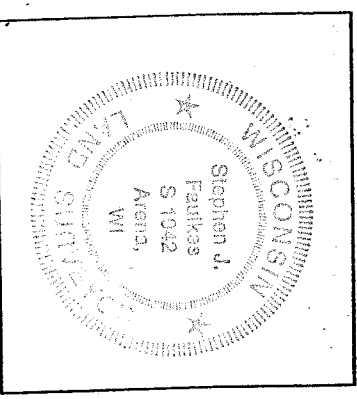

affix land surveyor seal