U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A–E 7.08 WI Administrative Code)

The SOUTH QUARTER corner of Section 23, T. 32 N., R. 11 E., Langlade County, WI

Corner was: (check all that apply)

- ☒ Restored through acceptance of an obliterated evidence location.
- ☐ Restored through acceptance of a found perpetuated location.
- ☐ Determined to be lost and re–established through proportionate methods. (Show bearings and distances to PLSS corners used for proportioning.)
- ☐ Restored/recovered/reestablished in a location that differs from a previously established position. (Show difference in plan view below.)

321123 0020

☐ Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1860 by Hiram C. Fellows. Original bearing trees: birch, 25", S10°W, 15 links, and an elm, 10", N40°E, 20 links. Orig. distances on south line Sec 23 = 2661.12'. In 1902, Webley used this corner but didn't describe it. He measured 2644.62' to the section corner east. April 13, 1998 Dave Tlusty and Tom Arnott dug with back hoe at old corner fence post point, with resident witness Clint Heinzen. Found no other physical evidence. The corner fence post point was from the post Mr. Heinzen set a long time ago to replace an older corner fence post. Based on Mr. Heinzens testimony I accepted the fence corner as the best evidence of corner location. For the corner, I set a 2" x 30" iron pipe with brass cap in mound of stones.

Physical description of the monument set:

For the corner, I set a 2" x 30" iron pipe with brass cap in mound of stones.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

O = 3/4" x 30" rebar with red plastic cap
Set white vinyl sign post 1' north of corner.
Bearings referenced to section line shown.

FB 14-93

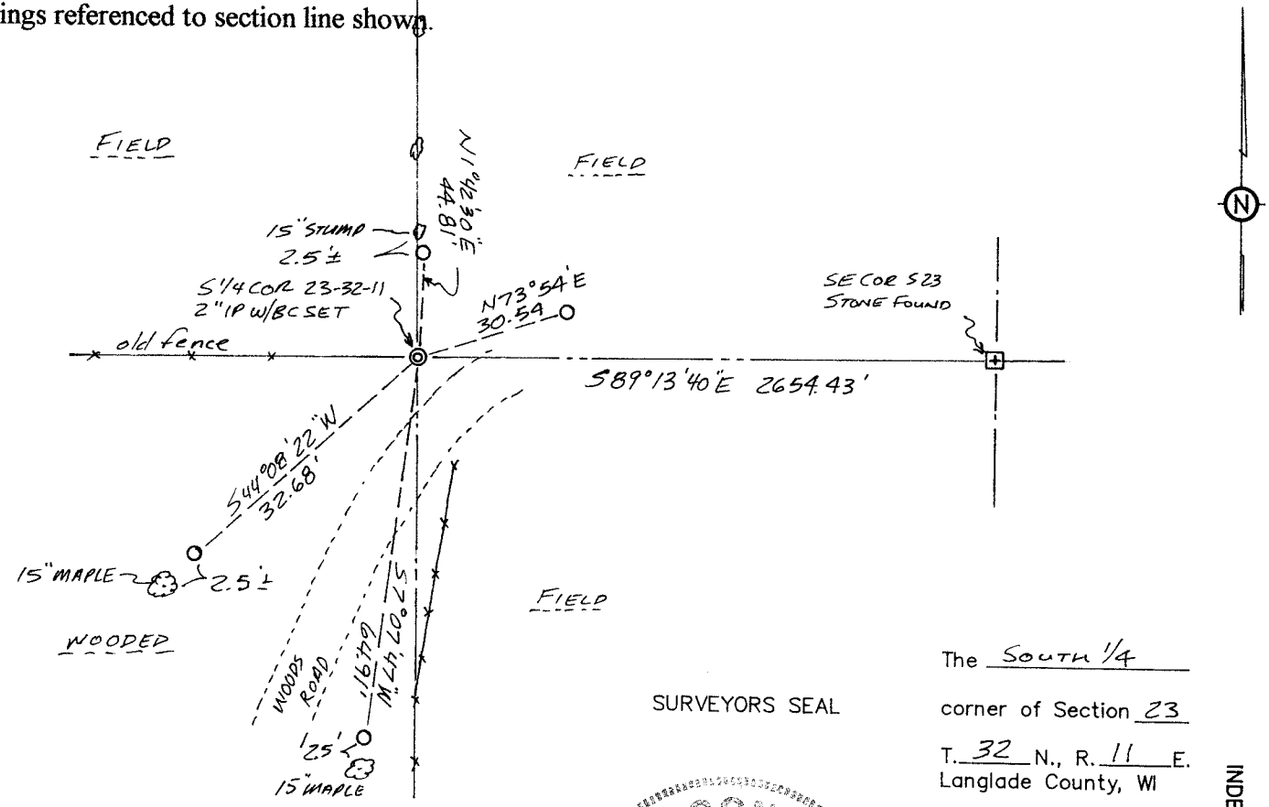

SURVEYORS SEAL

WISCONSIN
DAVID E. TLUSTY S-1390 ANTIGO WIS.
REGISTERED LAND SURVEYOR

I, DAVID E TLUSTY, LANGLADE COUNTY SURVEYOR, certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

D E Tlusty 7/2/99

Signature Date

The SOUTH 1/4 corner of Section 23
T. 32 N., R. 11 E.
Langlade County, WI

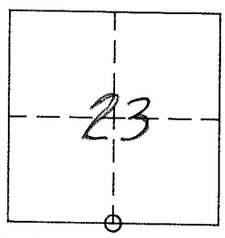

O = Location of corner

INDEX No. R19