


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

I N S T R U C T I O N S : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- O = Corner monument restored.

Corner common to Sections 21, 22, 27, and 28, T.32N., R.14E., Langlade County, Wisconsin.

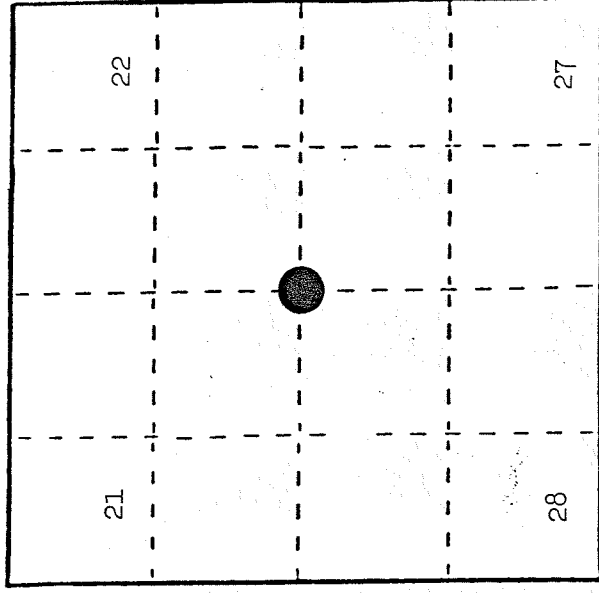

T 32 N R 14 E


(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Alfred Millard set post for corner and made the following bearing trees: Sugar, 14", N.33°W., 21 links; Hemlock, 12", S.25°E., 30 links.

In the 1930s, Nels Sandberg found a scribed Hemlock post, 4" x 4" x 30", in fair condition. Set location poster on Aspen, 4", S.89°E., 11 links.

In 1987, Alan Harrison found rock mound with post hole in center. At East, 7', found 9" Aspen with scar 5' high which was chopped out to uncover overground location poster. Post hole was accepted and monumented as best evidenced location.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

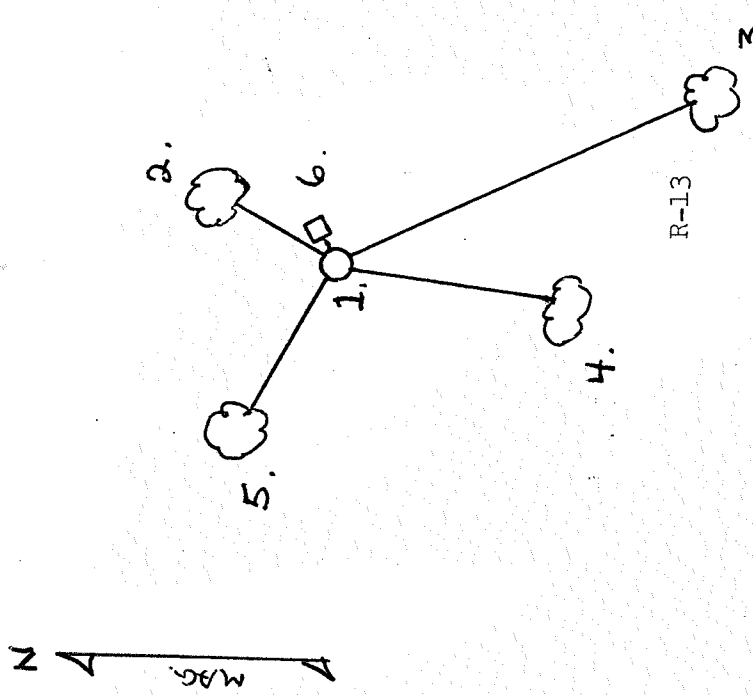

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument stamped to identify corner location.
2. White Birch, 11", N.28°E., 11.44 feet
3. Sugar, 4", S.35°E., 42.24 feet
4. Sugar, 9", S.7°W., 23.36 feet
5. Sugar, 8", N.63°W., 16.93 feet
6. Steel Sign Post, Northeast, 0.99'

R-13

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

(1) Alan D. Harrison Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 6/27/88
Signature Date

Ray Decker District Ranger
OK M.S. 10/2/88

