


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

**I N S T R U C T I O N S :** This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Corner common to Sections 2-3-34-35,  
T.31-32N., R.14E., Langlade County,  
Wisconsin.

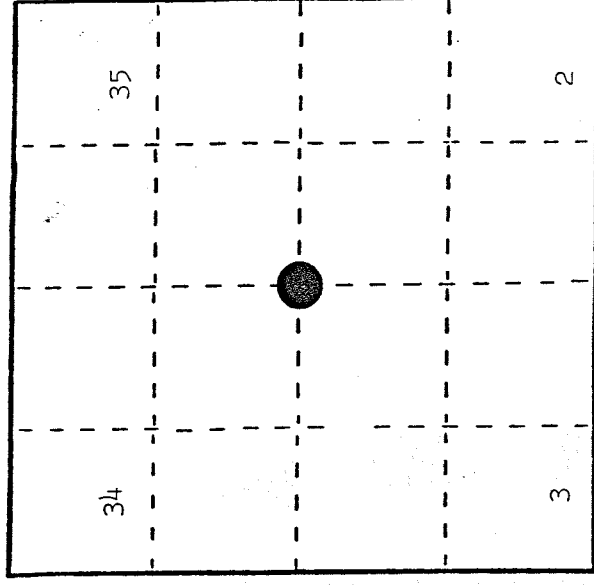

(b) Describe any record evidence, monument evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Alfred Millard set wood post for corner and made the following BTs: Cedar, 12", N.18°W., 31 links; Cedar, 11", N.25°E., 8 links; Cedar, 12", S.25°W., 11 links; Hemlock, size unknown, S.42°E., 13 links.\*

In 1933, Arthur Wolf found a 4" x 4" x 4" x 30" wood stake in fair condition. He noted that a small creek flowed on east side of post and post was on south side of fence line of deer farm.



In 1988, Alan Harrison searched for corner at the proportional position. From a point 2.5'± south of fence and 3' from west bank of old creek bed found a 12"-14" Cedar blowdown at S.25°W., 7.26'. Also found natural feature calls to fit well in all directions. Accepted this position as original corner location and placed a 2½" x 36" aluminum monument.

\*See (g&h) for original feature calls.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Double Cedar, 6", S.84°E., 32.88 feet
3. Cedar, 4", S.11°E., 39.23 feet
4. Cedar, 10", S.79°W., 86.20 feet
5. Steel Sign Post, 6', East, 0.33 feet

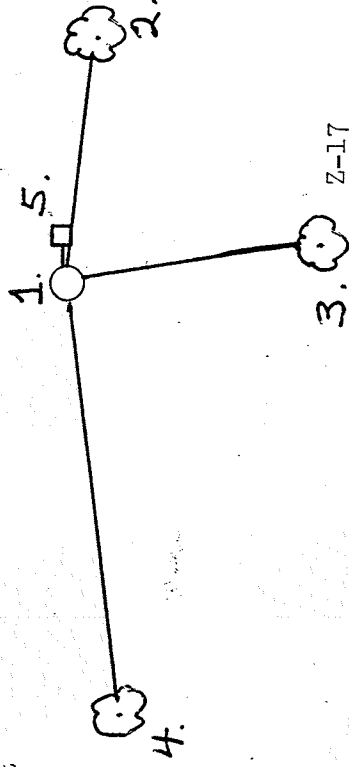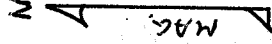

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

\* (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

NATURAL FEATURE

ORIGINAL CALL

1988 DISTANCES ±1.0'

Creek, 10 Links  
Enter Swamp  
Creek, 8 Links  
Creek, 8 Links  
Creek, 12 Links  
Leave Swamp  
Leave Swamp

East, 0.10 Chains  
East, 2.00 Chains  
South, 0.50 Chains  
South, 3.00 Chains  
North, 0.65 Chains  
North, 3.00 Chains  
West, 6.00 Chains

7.0 Feet  
132.0 Feet  
33.0 Feet  
200.0 Feet  
43.0 Feet (North Edge of Road)  
200.0 Feet  
400.0 Feet

(1) Alan D. Harrison  
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison 6/27/88 O.R. M.S. Kelly  
Signature Date

Certificate ready for filing: Alan D. Harrison

District Ranger

