


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

I N S T R U C T I O N S : This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
- = Corner monument restored.

Corner common to Sections 35 and 36, T.32N., R.14E., and Sections 1 and 2, T.31N., R.14E., Langlade County, Wisconsin.

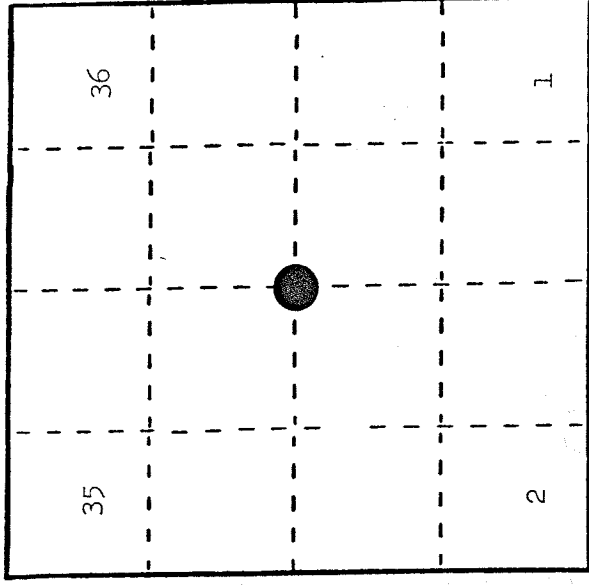

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed. In 1857, Alfred Millard set wood post for corner and made the following BEs: Yellow Birch, 14", N.30°E., 15 links; Hemlock, 10", N.76°W., 46 links; Hemlock, 24", S.15°W., 58 links; Yellow Birch, 14", S.51°E., 45 links.

In 1968, Jean Resvick (RLS) found a scribed wood post lying along with an old rotted post on ground with a bed rail driven in the post point in the ground. A Marathon location poster is on a tree southwest of corner. Found no original evidence for corner.


In 1982, John Fisher (RLS) found the evidence as per Resvick and accepted rail as best evidence location of corner and replaced rail with a 2½" x 36" aluminum monument.

In 1988, Alan Harrison (RLS) found corner as per Fisher. Found no recorded certificate and is filing this one.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 2½" x 36" aluminum monument with tablet stamped to identify the corner.
2. Red Pine, 7", N.08°E., 23.25 feet
3. Red Pine, 7", S.51°E., 15.88 feet
4. Red Maple, 7", S.01°E., 47.31 feet
5. Oak, 6", S.56°W., 11.33 feet
6. Steel Sign Post, South, 1.0 feet

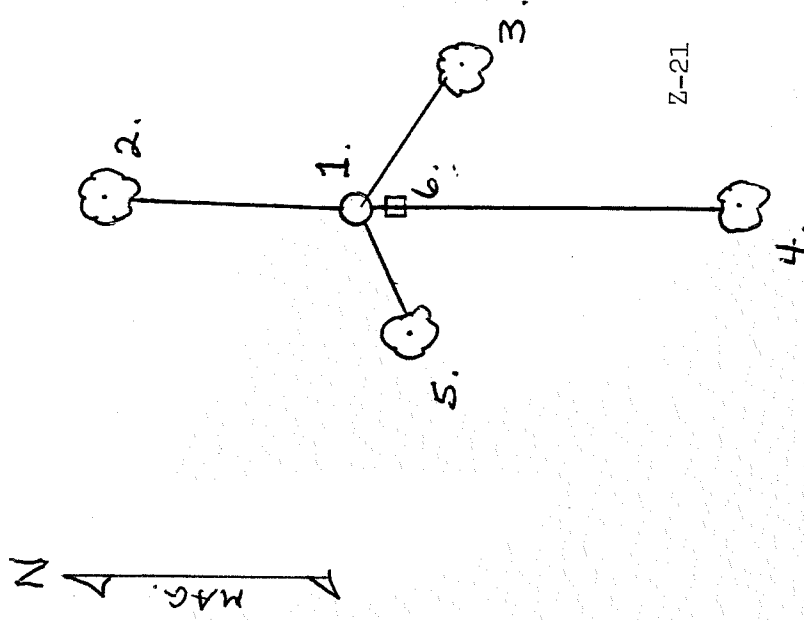

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

Alan D. Harrison

(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

6/27/88
Date

Certificate ready for filing:

Alan D. Harrison
District Ranger

