

LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The South 1/4 corner of Section 17, T. 33 N., R. 9 E., Langlade County, WI.

Corner was: (check all that apply)

43309170020

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
- Determined to be lost and re-established through proportionate methods.
 - Show bearings and distances to PLSS corners used for proportioning, and show original distances).
 - Restored/recovered/re-established in a location that differs from a previously established position.
- (Show difference in plan view below).
 - Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1860 by Hiram C. Fellows. Original bearing trees: birch, 8", S32°W, 7 links and a hemlock, 7", N35°E, 6 links. In 1902, Webley (FB126-4) "commenced at the 1/4 post bet Sec 17 & 20, one original BT standing, stone set by Hutchinson". June 12, 1936, C.H. Parker reestablished the corner based on resident testimony on the previous evidence, and set a field stone for the corner, approx. 18" long x 10" across at the bottom, with the top end of the stone triangular. 06/11/01 D. Tlusty, Emily Tlusty and Mike Kielcheski dug with backhoe. Down 1.5', found a triangular stone. This was the only stone found. From Parkers statement, it appears that the Hutchinson stone was not found by someone else searching for the corner and that Parker set a new stone "based on resident testimony" I accept it as the best evidence of the original corner location.

Physical description of the monument set:

Left the stone in place and set a 1" x 30" iron pipe on the NW side of the stone.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

LEGEND

- o 3/4" x 30" rebar set flush
- ▶ 60d nail set

The bearings are Langlade County Coordinate system grid bearings.

rebar set 3' north of stop sign

South 1/4 corner, 17-33-09 Found stone.

SW corner, Sec 17 Found stone.

SE corner, Sec 17 Found stone.

S 88°31'54" W 2661.46' (1936 resurvey S 88°22' W 2661.06')


S 88°53'50" E 2694.17' (1936 resurvey N 89°05' W 2693.99')

rebar set 5' south of street sign

power pole

60d nail set upright in SE root 22" maple

Langlade County Coordinates based on RTK GPS with base receiver set on point of known NAD83(91) values
N 41°29'40" E 67.85'
E 412281.83 558243.99 1/4 corner

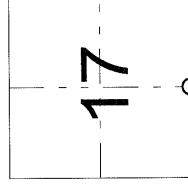


Index No. N7 33-09

O = corner perpetuated

The South Quarter corner of Section 17, T. 33 N., R. 9 E., Langlade County, WI

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.

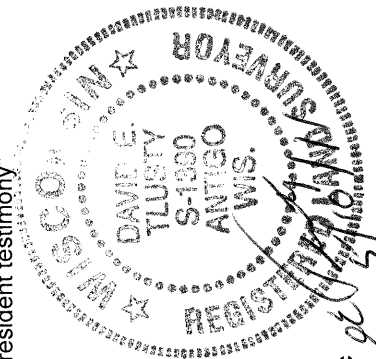

Field book: FB4-154

