U.S. PUBLIC LAND SURVEY MONUMENT RECORD


INSTRUCTIONS

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

The Southeast Corner of Section 8, Township 33 North, Range 12 East, Langlade County, Wisconsin.

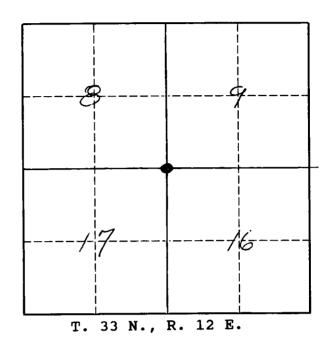


(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed. The original corner was established in 1865 by James Nowlin. Original BT's were: Birch, 10", S75°E, 15 lks., and a Hemlock, 8", S35°W, 5 lks. Surveyor E.S. Brooks found evidence of the original bearing trees and set a stone, 18" x 28" x 30" with an "x" on top. In the 1930's resurvey of part of this township, the stone and Brooks' BT's were recovered. In the 1930's survey, a WC (4" iron pipe with brass cap) was set 2 lks south of the corner. Also marked was a grey stone, 3' x 3', N47°E, 18.3 lks (12.08'), and another grey stone, 4' x 4', S38°W, 49.1 lks. (32.4'). On 3/5/94, I found the corner stone, the NE witness stone and the 4" IP witness pipe as shown below. I find a 4' x 4' stone at correct distance, bearing approx. S68°W, but no "x". I accept the stone with chiseled "x" as original corner location.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

Describe witness monuments

Bearing trees described below. All painted blue. Corner is approximately 150 feet north of an improved logging road bearing S60°E.

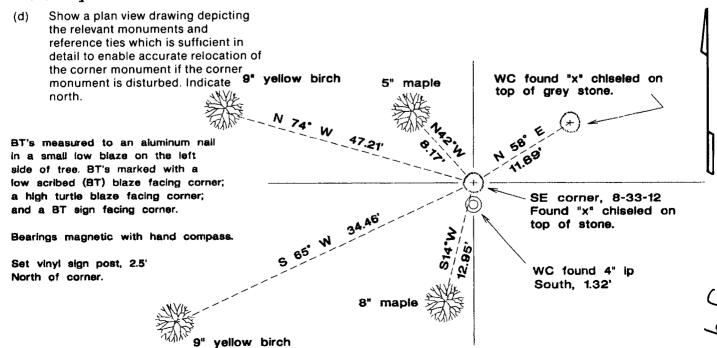

Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NO DISCREPANCY

(f)	Was the corner restored through acceptance of (1) an obliterated evidence location,	or (2)	a)found perpetuated location.?
٧٠/		/	2 For Portunion Tooding!!!

(g & h)	Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions
	and distances to other public land survey corners used as evidence or used for proportioning in determining the corner
	location

(i) (type or print name)

certify that the corner location shown on this record was determined by me or under $my\ direction\ and\ control\ and\ that\ this\ U.S.\ Public\ Land\ Survey\ Monument\ Record\ is$ correct and complete to the best of my knowledge and belief.

ANI WIS.
WIS.

ANI WIS.

ANI WIS.

ANI WIS.

Affix Landinus Property or Seal

DAVID E