

43313350020 2008

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

(Prepared and as required by S. A-E 7.08 WI Administrative Code)

The South 1/4 corner of Section 35, T33N-R13E, Langlade County, WI
Corner was (check all that apply)

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
- Determined to be lost and re-established through proportionate methods. (show bearings and distances to PLSS corners used for proportioning.)
- Restored/recovered/re-established in a location that differs from a previously established position. (Show difference in plan view below.)
- Check here if additional information is shown on the reverse side of this form.

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence, and all other evidence considered in the recovery/restoration of the corner.

Original June 1857- A. Millard set 1/4 post and marked two Bearing trees; Hemlock S38°W, 27 Inks; Sugar N 59° E, 16 Inks.

January 1984- Sluith (Owens-Illinois) set an iron pipe as part of a survey in Section 35, T33N-R13E. No corner form of record.


April 1984- W. Kelly found a " 2 inch brass-cap, Blank " at an intersection of a fence running South and East. Stamped cap and blazed four new bearing trees; 12" Yellow Birch, N 75° W, 16.30'; 10" Maple, N 32° E, 21.60'; 10" Maple, N 65° E, 17.70'; 10" Maple, S 14° W, 4.00'.

November 2007- I found Kelly's bearing trees (3 living and one dead). The bearing trees tied to a 60d nail on a northerly facing slope approximately 3/4 of the way to the top of said slope. The fences mentioned above were gone, and the area had been disturbed.

Physical description of the monument set:

November 2007- I replaced the found 60d nail with a 2.375" X 30" iron pipe with brass cap monument at the corner location, I also set a white vinyl post with a Langlade County survey marker sticker 1 1/2" North of the monument, and marked one new bearing tree with a Langlade County bearing tree plaque and marked the existing bearing trees with Langlade County bearing tree plaques and tied as follows.

Describe the accessories used to perpetuate the location of the corner. Include a plan view drawing and indicate accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

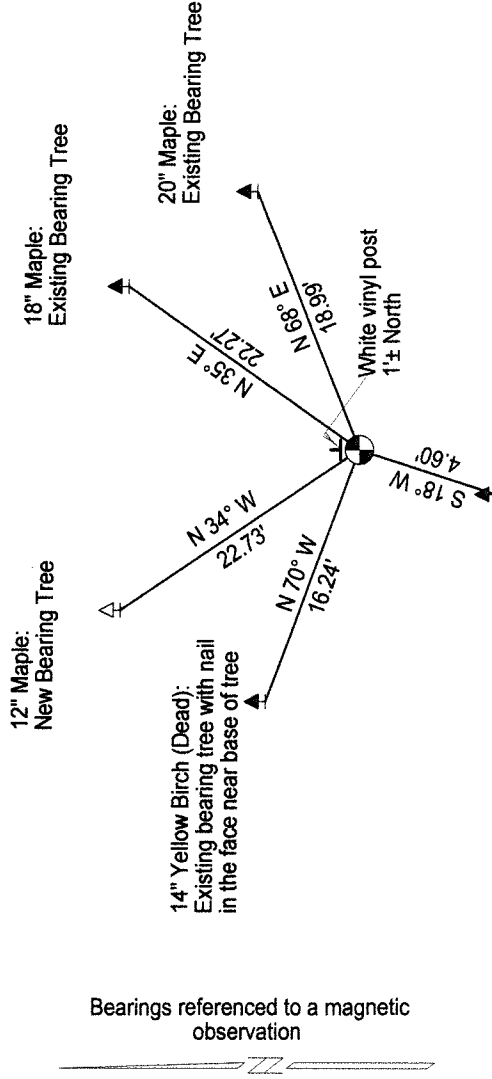


Note:
Not drawn to any scale.

All Bearing Trees marked with
Langlade Co plaque and aluminum
nail in the side of tree near the base

Distances measured with
a steel tape, bearings with
a hand held compass

The South 1/4
Corner of Section 35
T33N, R13E,
Langlade County, WI

SURVEYORS SEAL

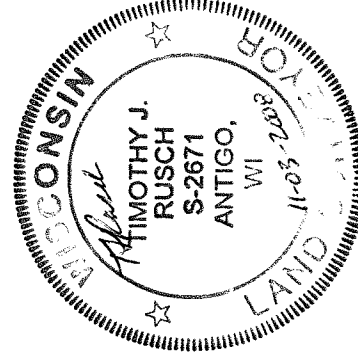

I, Timothy J. Rusch, certify that the
corner location shown on this record was determined
by me or under my direction and control and that this
U.S. Public Land Survey Monument Record is correct
and complete to the best of my knowledge and belief.

Timothy J. Rusch 11-03-2008
Signature Date

