


U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.
 ○ = Corner monument restored.

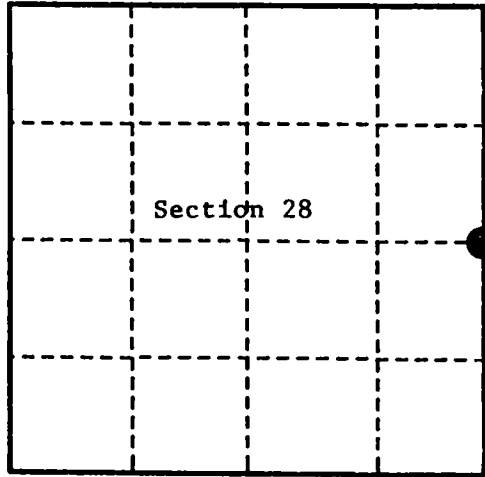

Quarter Corner between Sections 27 and 28, T33N. R14E., Langlade County, Wisconsin.

State Plane Coordinates, Wisconsin Central Zone
 N - 541941.65
 E - 2292349.96

Geographic Coordinates
 N - 45-18-46.680
 W - 88-44-28.043

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Original Survey in 1865 by J.L. Nowlin. North between Sections 27 and 28, at 40.00 chains set wood post and made the following bearing trees: Sugar, 20", S.36°E., 35 links (23.10 feet), Sugar, 12", N.72°W., 40 links (26.40 feet), 5.0 chains North, enter swamp, bears SW and NE.


In 1937, N. Sandberg, C.C.C. enrollee, found a 6" X 6" squared wood post from which a Maple, 20", bears S.60°W., 58 links (38.28 feet).

In 1982, Milo Stefan, RLS, found a 8" X 8" squared and scribed wood post. Found original bearing tree stumps. In place of post set a 2" X 36" aluminum monument with an aluminum cap stamped to identify corner. Blazed and scribed the following bearing trees: Y.Birch, 10", N.45°E., 12.24 feet, Sugar, 6", S.17°E., 16.84 feet, Sugar, 6", S.32°W., 10.75 feet, Y.Birch, 12", N.54°W., 8.22 feet, Steel Sign Post, South, 3.20 feet.

In 1996, Alan Harrison, RLS, found monument and bearing trees as set by Milo Stefan in 1982. Cut down all bearing trees for G.P.S. observations and made new bearing trees as noted below.

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

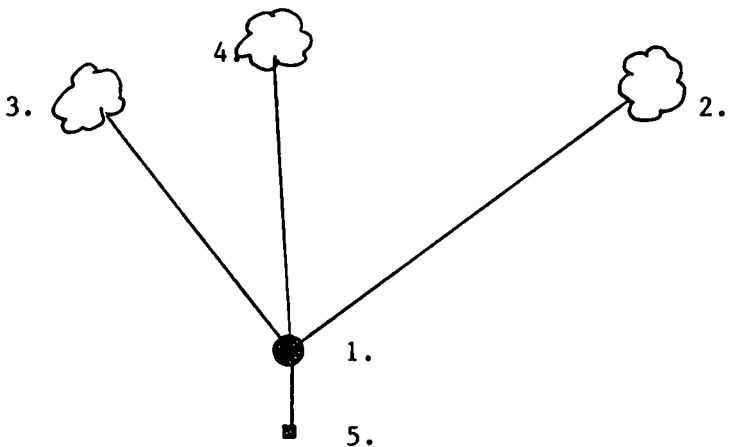

1. 2" X 36" aluminum monument stamped to identify corner.
2. Sugar, 9", N.51°E., 52.49 feet.
3. Sugar, 15", N.46°W., 38.18 feet.
4. Sugar, 14", N.04°W., 31.92 feet.
5. Steel Sign Post, South, 3.20 feet.

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d). above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.


None

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location ?

(2) a found perpetuated location

(g & h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No

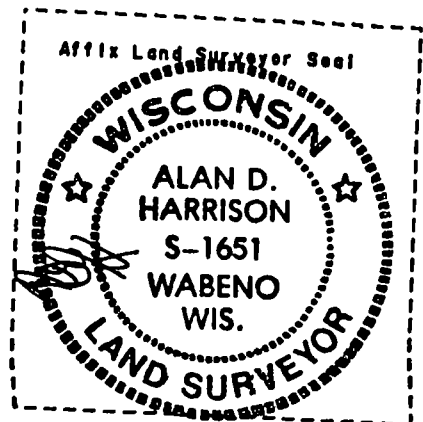

I, Alan D. Harrison

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

1/7/97
Date

CERTIFICATE READY FOR FILING:

[Signature]
District Ranger

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Langlade } ss.

I Milo E. Stefan, do hereby certify that on the 26th day of October, 1982, I found evidence of the West Quarter corner of Section 27 Township 33N, Range 14E, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:


Surveyed in 1865 by J. L. Nowlin
40.00 chains, set wood post
Sugar, 20", S36°E, 35 lks., 23.1'
Sugar, 12", N72°W, 40 lks., 26.4'

Description of corner evidence found:

Sugar stump, S36°E, 16.5' (Suspect a 10 lk. error in field notes)
Sugar stump, N72°W, 26.4'
Local Evidence: Found scribed Cedar post 8" x 8" x 20"
Stump call north fits well

Description of monument and accessories I established to perpetuate the location of this corner:

Placed a 2" x 36" aluminum monument in mound of stone with tablet stamped as follows:
T33N, R14E, 1/4, S28, S27, 1982, RLS-1558
From which the following bear:
Yellow Birch, 10", N45°E, 12.24'
Sugar, 6", S17°E, 16.84'
Sugar, 6", S32°W, 10.75'
Yellow Birch, 12", N54°W, 8.22'
Steel Sign Post, South, 3.2'

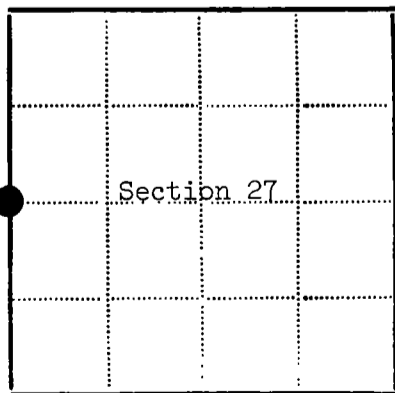

● - Corner monument restored
□ -

Resident witnesses.....

Dated at Rhinelander, Wisconsin, this 2 day of MAY 1982..

Signature Milo E. Stefan Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. RLS-1558.....

Office of..... County of.....

I hereby certify that the within instrument was filed in this office for record on the..... day of..... 19....., and was filed in Book No..... Page No..... of County Records.

Signature..... Title.....

T-13