
## U. S. PUBLIC LAND SURVEY MONUMENT RECORD

INSTRUCTIONS:

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

(a) Identify the corner by reference to the U.S. public land survey system.

O = Corner monument restored.

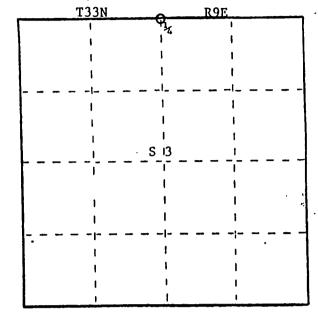

(b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

Recovered Langlade County monument 4" diameter iron pipe with 4" brass cap N6 14'W 75.84' of the original position set by Langlade County Surveyors in 1938. Recovered their Hemlock 15" stump S20W 94.7 links and Cedar stump N65E 54.80'. Reset monument using old B.T. ties.

(c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.) Describe witness monuments.

Φ 1" x 4½' I.P.

N4W 30.0'

20.0

(d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed, indicate north.

T33N-R9E S34  $\frac{1}{4}$ S3

T.K. D.H.

1" x 4½' I.P. g 25.20' 520E 16.0'
1" x 4½' I.P.

4" x 3' Iron Pipe 4" diameter Brass Cap.

34-9

1" x 4½' I.P.

20-15

and (1) the corn	distances between the corner as previously restored	
monuments shown	in the drawing in (d), above.	s

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?
- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Oate (i)

Affix Land Surveyor Seal

GLEN

BARKER

S-1682

CRANDON BAHNL. S-1682 CRANDON WI