

CERTIFIED LAND CORNER RESTORATION

Index No. V-20

State of Wisconsin }
County of Langlade } ss.

History of original corner establishment:


Corner established in 1937 by Langlade County surveyors.

I Daniel K. Pleoger, do hereby certify that on the 29th day of October, 1980, I ~~found~~ re-established the E 1/16 corner of Sections 26 and 35 Township 34, North, Range 10 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Description of corner evidence found:

Recovered top portion of old 4" squared cedar post scribed E 1/16 - S35 - no evidence of old point.
Ran traverse from section corner 25-26-35-36 to 1/4 corner between sections 26 and 35 for a distance of 2618.248 feet at bearing N88-13-50W. Set E 1/16 corner 1309.124 feet intermediate.

Resident witnesses:

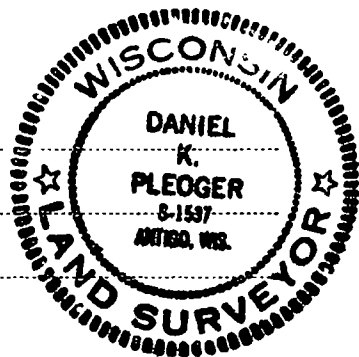

Description of monument and accessories I established to perpetuate the original location of this corner.


Set a 1-1/2" I.D. iron pipe with screw-on brass cap, stamped:
Projecting 12" above ground.

Marked NBT's:

Maple 6" N43°W 23.96 feet
Maple 6" S50°W 22.09 feet scribed 1/16 B.T.
Maple 4" N4°W 6.38 feet

T34N R10E
E 1/16 S+26
S+35
S1537-1980

FORM 985 H. C. MILLER CO., MILWAUKEE

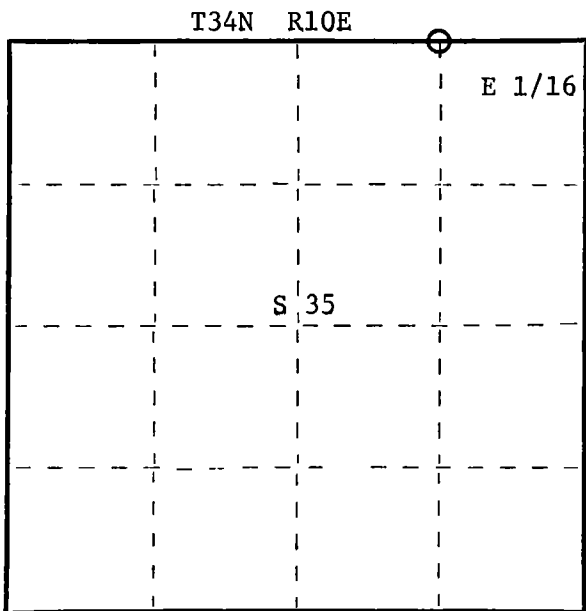

○ = Corner monument restored.

Dated at Rhineland, Wis., this 23rd day of February, 1981.

Signature Daniel K. Pleoger Title Registered Land Surveyor Registration No. 1537
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____ at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy