

CERTIFIED LAND CORNER RESTORATION


Index No. T-15

State of Wisconsin }
 County of Langlade } ss.

I Daniel K. Pleoger, do hereby certify that on the 14th day of August, 1980, I ~~found~~ established ~~the~~ C 1/4 corner of section 27 Township 34, North, Range 10 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.


Resident witnesses:

FORM 985 H. C. MILLER CO., MILWAUKEE

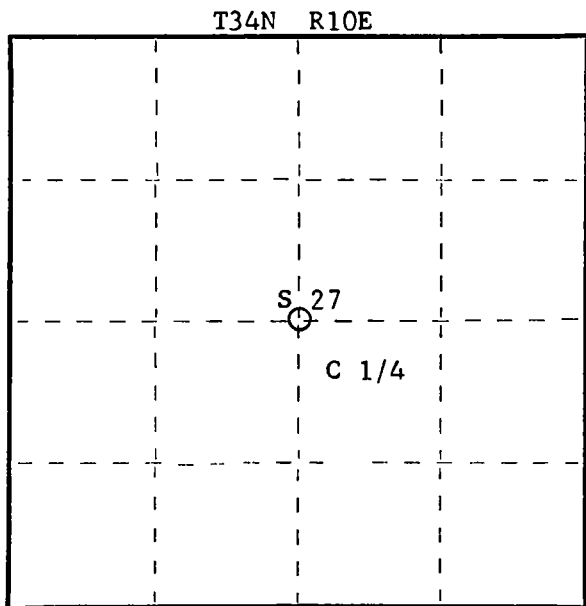

○ = Corner monument restored.

History of original corner establishment:
 No evidence of any previous corner.

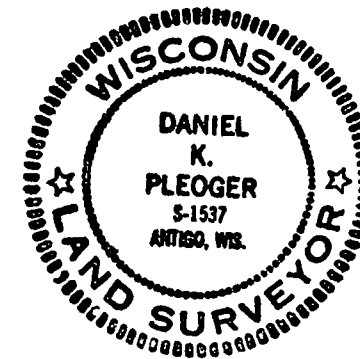

Description of corner evidence found:

Corner established by subdivision of section 27.
 Corner sets at the intersection of N-S and E-W 1/4 lines,
 S1-12-57W 2705.517 feet of N 1/4 corner
 S89-02-58W 2470.295 feet of E 1/4 corner
 N1-12-57E 2583.233 feet of S 1/4 corner
 N89-02-58E 2598.873 feet of W 1/4 corner.

Description of monument and accessories I established to perpetuate the original location of this corner.

Drove a 1" x 16" iron pipe 5 feet west of centerline in Brady Lane 5" below surface for true corner.

Set two (2) 1-1/2" I.D. iron pipes with screw-on brass caps for witness corner - stamped:

Marked NBT's to true corner -
 Maple 6" N13°W 42.77 feet
 Maple 8" S58°W 42.69 feet
 Maple 7" S37°E 40.68 feet
 scribed 1/4 B.T.

#1	#2
T34N R10E	T34N R10E
C 1/4 S + 27	C 1/4 S + 27 W.C.
E - 35 ft	N68W 29.75 ft.
S1537-1980	S1537-1980

Dated at Rhineland, Wis., this 16th day of October, 1980.

Signature Daniel K. Pleoger Title Registered Land Surveyor Registration No. 1537
 (County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____ at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy