


CERTIFIED LAND CORNER RESTORATION

Index No. T-13


State of Wisconsin }
County of Langlade } ss.

I Daniel K. Pleoger, do hereby certify that on the 10th day of August, 19 80, I found evidence of the Quarter corner of Sections 27 - 28 Township 34, North, Range 10 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

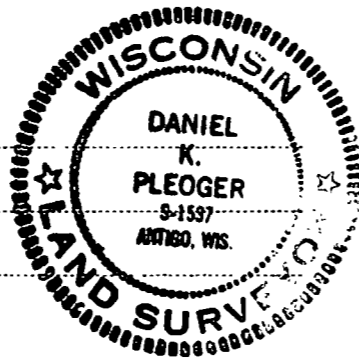

FORM 983 M. C. MILLER CO., MILWAUKEE

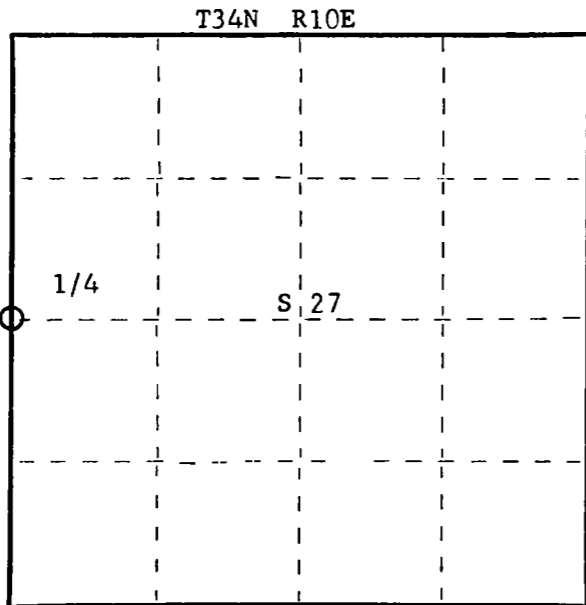

○ = Corner monument restored.

History of original corner establishment:

Original corner established by J.L. Nowlin, in 1865, from which Sugar 14" bears N50°W, 20 links and Birch 12" bears S22°E 10 links.
Old corner recovered in 1937 by Langlade County surveyors.
Recovered original birch B.T. down and the remains of the rotted sugar.
Set a 4" iron pipe filled with concrete and brass capped.
Marked NBT - Hemlock 8" S35°W 13.9 links.

Description of corner evidence found:

Recovered a 4" iron pipe filled with concrete and brass capped.
Monument projects 12" above ground.
OBT - Hemlock 8" (10") S35°W 13.9 links
scribing grown over.

Langlade County
T34N R10E
1/4 S 28 + 27
11-11-37

Description of monument and accessories I established to perpetuate the original location of this corner.

Monument left as recovered.

Marked NBT's -
Sugar 8" N89°E 10.59 feet
Sugar 8" S52°E 16.93 feet
Sugar 7" S71°W 19.36 feet
scribed 1/4 BT.

Dated at Rhinelander, Wis., this 26th day of November, 19 80

Signature Daniel K. Pleoger Title Registered Land Surveyor Registration No. S-1537
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19 _____ at _____ o'clock _____ M.

(Register of Deeds)

By _____ Deputy