

LANGLADE COUNTY U.S. PUBLIC LAND CORNER RESTORATION

The East 1/4 corner of Section 2, T. 34 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply)

- Restored through acceptance of an obliterated evidence location.
- Restored through acceptance of a found perpetuated location.
- Determined to be lost and re-established through proportionate methods.
- Show bearings and distances to PLSS corners used for proportioning, and show original distances).
- Restored/recovered/re-established in a location that differs from a previously established position.
- (Show difference in plan view below).

4341102 2000

Check here if addition information is shown on the reverse side of this form.


Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

The original corner was established in 1859 by William E. Daugherty. Original bearing trees: tamarac, 6", S 32° W, 18 links and a yellow pine, 14", N9°E, 37 links. In 1904, B.F. Dorr, ran the line between Sections 1 & 2, found no evidence of the corner and reset it by proportionate methods, and marked two bearing trees. In 1921, Hutchinson ran the line between Sections 1 & 2 and said "Stone set by Dorr had been dug out but re-set it from his BT. 8 x 12 x 12 w "4" on top". In 1990, former surveyor Kelly whacked in a nail at the intersection of the roads, called it the quarter corner and set an aluminum witness monument 31.00' East. July, 2005, Brinkmeier, surveying in SE-SE of Section 2 found that Hutch's distance from the SE section corner running North hit a sixteenth line fence really good and a fence east at this quarter corner really good, but was about 20 feet south of the Kelly corner. July 14, 2005, D. Tlusty, Jason Thom, dug with County backhoe and found the stone described by Hutchinson. Went West and recovered Hutchinsons well point and ran to Center of Section 2. Found that Hutchinsons data fit very well with the recovered stone and well point. I accepted the stone as the best evidence of the corner. Kellys "corner" PK is 21.18' to the North as shown below.

Physical description of the monument set:

For the corner, I set a 1" x 30" iron pipe in place of the stone found. Top of pipe is 1.5' below road. Placed the found stone just above and to the west of the pipe set. Set a 60d spike in fresh hot mix patch for corner.

Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

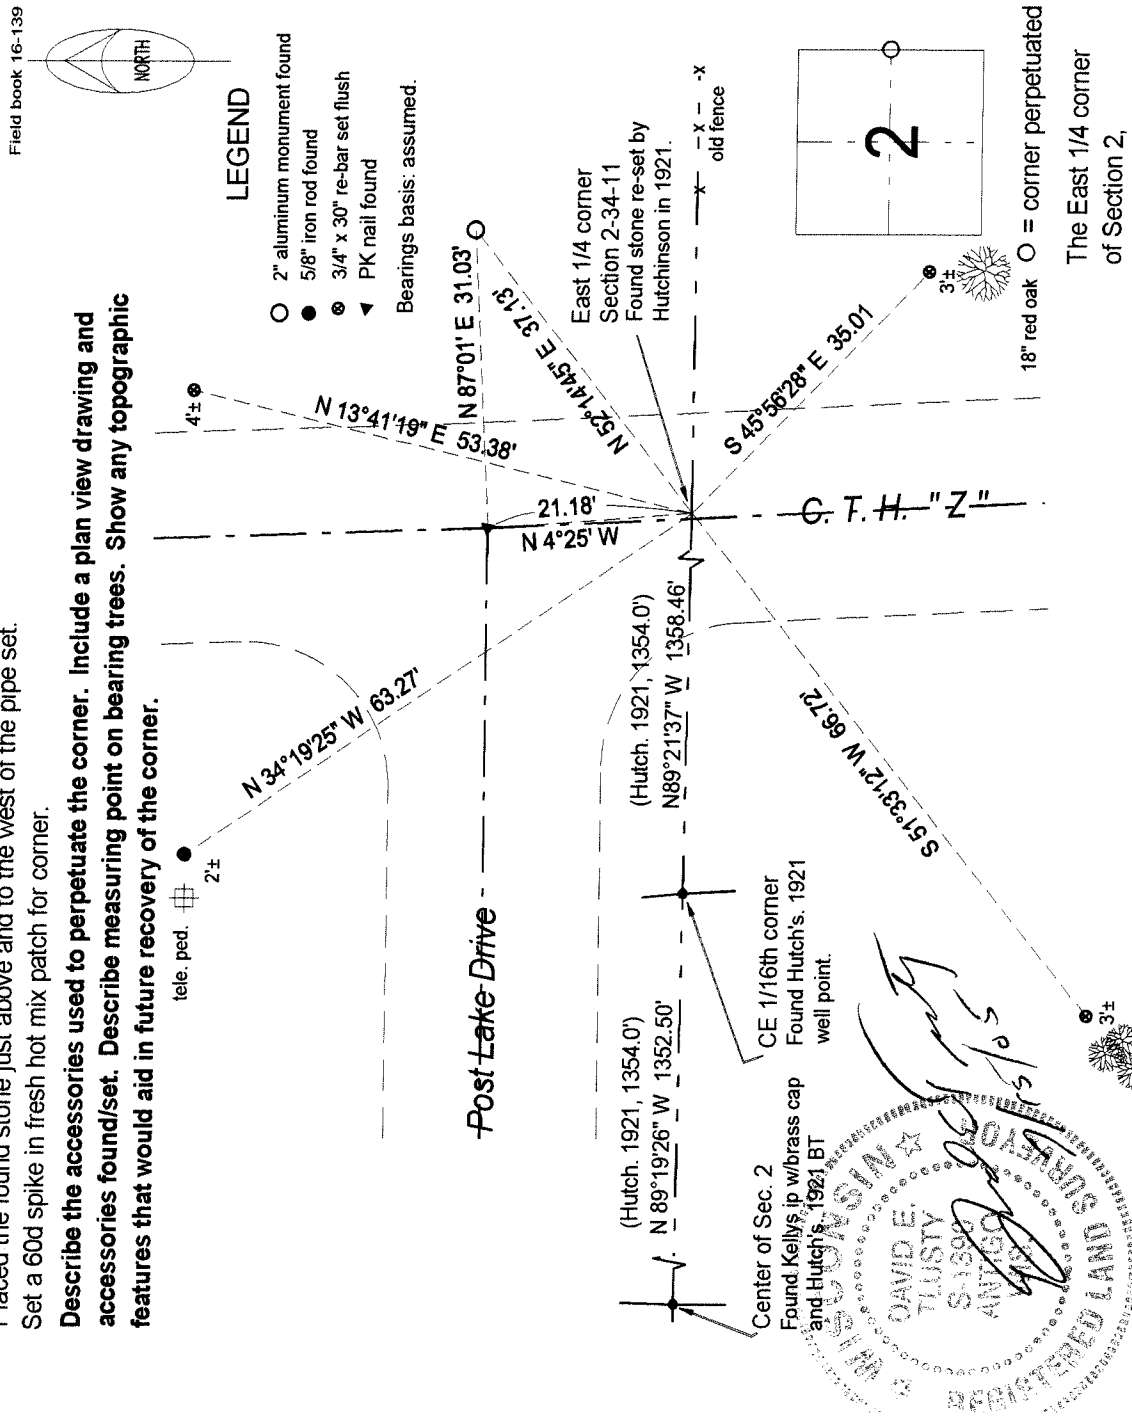

Index No.

C21 34-11

The East 1/4 corner
of Section 2,
T. 34 N., R. 11 E.,
Langlade County, WI

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.

oak cluster