


U S PUBLIC LAND SURVEY MONUMENT RECORD - ADDENDUM

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-f)

A-E 7.08(3)(a) Identity of corner
SOUTH 1/4 CORNER OF SECTION 35
TOWNSHIP 35 NORTH
RANGE 11 EAST OF THE 4TH PM
TOWN OF SCHOEPEKE,
COUNTY OF ONEIDA

WISCONSIN - LANGLADE COUNTY
N: 459,046.508 USft (XXX,XXX.XX)
E: 639,464.175 USft (XXX,XXX.XX)
Datum: NAD83 (2011)
GNSS Method RTN - Direct
GNSS Control WISCORS VRS

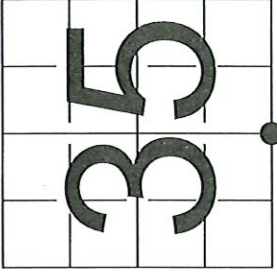

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Values shown in parenthesis, are previously published measurements.

A-E 7.08(3)(b) Description of any record evidence, monument evidence, occupational evidence, testimonial evidence, or any other material evidence.

Original Surveyor: Hiram C. Fellows (Note: previous monument record Z-19 refers to WM. Daugherty as the original surveyor)

Date of Original Survey	Commenced:	June, 1859	Original Accessories:	
	Completed:	July, 1859	Aspen	8 N 83° E 44 Links
			Spruce	7 S 89° W 53 Links

See Previous Monument Record: Index No. Z-19 - June 20, 1990 - Surveyor 1098 - William F. Kelly - THENCE:

April 16, 1998 - Surveyor 1795 - Devon J. Vanden Heuvel - indicates this position as "2" pipe W/cap" on Oneida Co. Map #B4186.
January 8, 2007 - Surveyor 1935 - Daniel E. Higginbotham - indicates this position as "2" brass cap pipe" on Langlade Co. Map #30567.
March 2, 2017 - Surveyor 2439 - Charles E. Oleinik - indicates this position as "2" IP W/brass cap" on Oneida Co. Map #A3245.
July 11, 2008 - Surveyor 1731 - Kip W. Soder - indicates this position as "iron pipe-brass capped monument" on Oneida Co. Map #B7059.
September 12, 2008 - Surveyor 2671 - Timothy J. Rusch - indicates this position as "brass capped iron pipe" on Langlade Co. Map #20375.
December 27, 2018 - Surveyor 2671 - Timothy J. Rusch - indicates this position as "brass capped monument" on Langlade Co. Map #10992.
June 17, 2020 - Surveyor 2671 - Timothy J. Rusch - indicates this position as "brass capped monument" on Langlade Co. Map #11030.


A-E 7.08(3)(f) Whether the corner was restored through acceptance of an obliterated location or a found perpetuated location.

April 28, 2022 - I found a 2.5" diameter iron pipe with a 2.5" brass tablet affixed to the top & stamped to identify the corner.
I also found 3 B.T.'s recovered or established as noted on Certified Land Corner Restoration Z-19.

I accept this monument as a FOUND PERPETUATED LOCATION OF THE CORNER and established 2 new witnesses as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with references to at least 4 witness monuments. If in disagreement with previously established corner, show the distances between the two corners and also indicate the ties to the disputed. The directions and distances to other public land survey corners used as evidence or used for determining the corner location.

BEARINGS LISTED TO THE NEAREST
SECOND ARE REFERENCED TO WISCONSIN
COUNTY COORDINATE REFERENCE
SYSTEM - LANGLADE COUNTY ZONE. ALL
OTHER BEARINGS ARE MAGNETIC

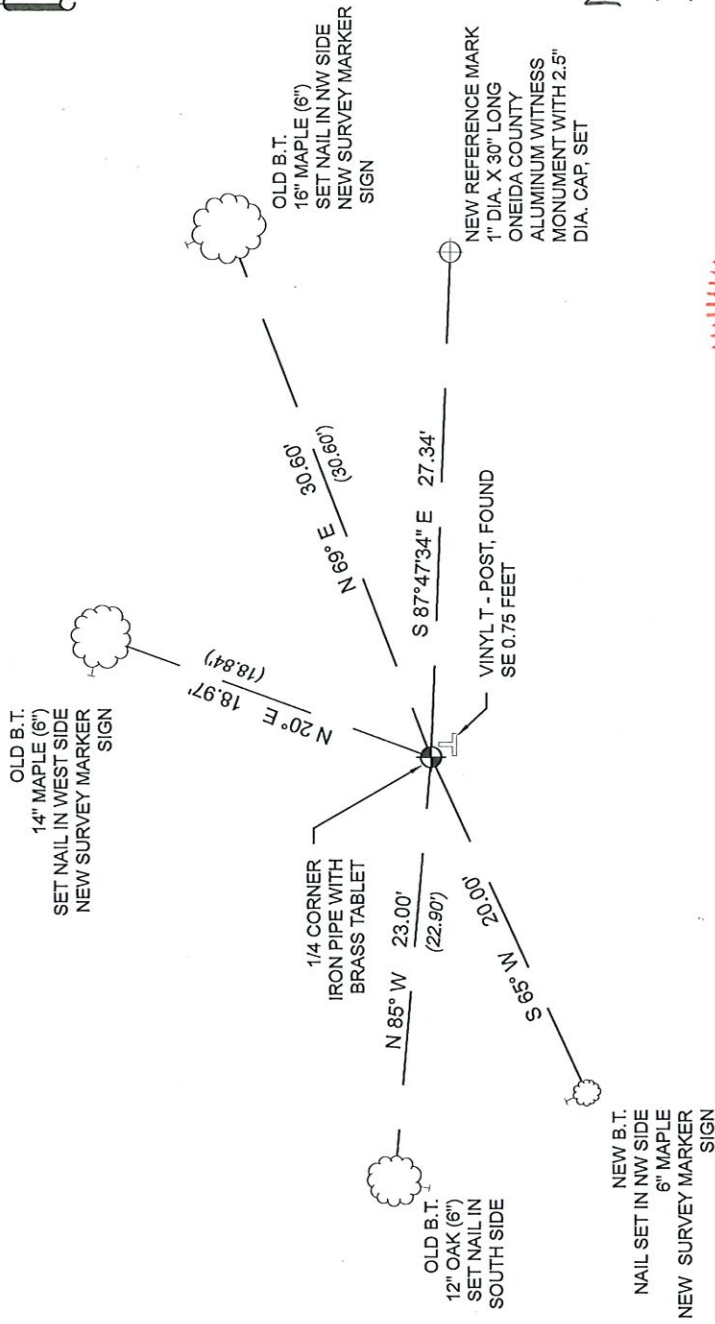

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief

Jeffrey L. DeMuth

August 16, 2022

DATE

SIGNATURE

43511350020


LANGLADE CO.



2-19 35-11

Index No. A-19

FORM-985 H. C. MILLER CO., MILWAUKEE

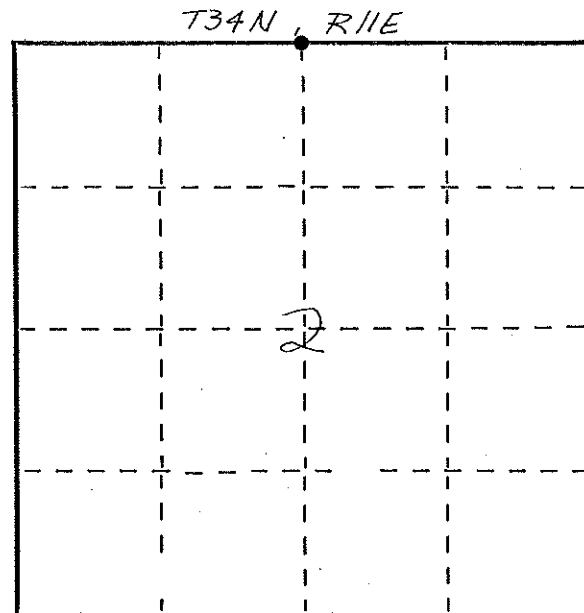

By.....Deputy